## R50i Static Alignment Mounting instructions

Verify the following items were received:

R50i Encoder Mounting Screws – 2 each Cover Setscrew wrench (1 per shipping tray)

Additional Items needed to complete installation:

Cable Assembly (Purchased separately) Mounting screw wrench (Not included) Servo cleats (not included)


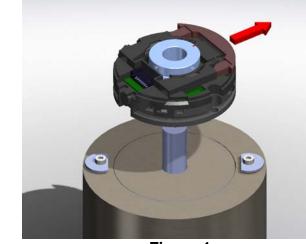


Figure 1

Energize appropriate motor windings to lock shaft. Verify slide is fully extended. If needed, apply threadlocker to mounting holes. Loosely install servo cleats with flat side facing shaft. Rotate hub so line on hub is 180° from connector. Slide encoder over motor shaft as shown in Figure 1.

Step 1:

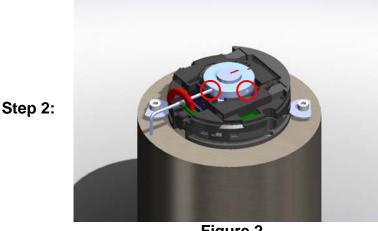


Rotate servo cleats to position shown in figure 2. Housing should be allowed to rotate, but not lift up. Torque both set screws to 20 oz-in.



Change:										
	Release-no.		Created	Responsible	Released		Version	Rev.	Sheet	Page
	04740 Name H		Rhodes	Rhodes	Rhodes	D655977	- 00 -	· B ·	· 01	1/
		Date	05.06.2009	31.07.2009	31.07.2009	Doc	ument no.			2



542543

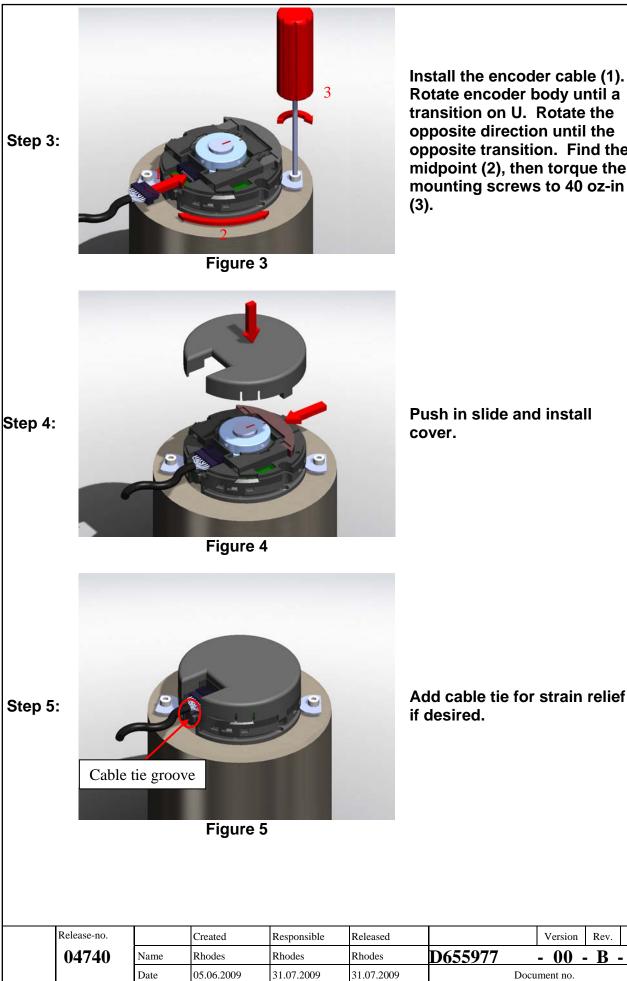

Install the encoder cable (1). Rotate encoder body until a transition on U. Rotate the opposite direction until the opposite transition. Find the midpoint (2), then torque the mounting screws to 40 oz-in

Sheet

01

Page 2/

2

Rev.

B

-

Version

00 -

-

Document no.

