



HEIDENHAIN

LIC 4119 FS

Mounting Instructions

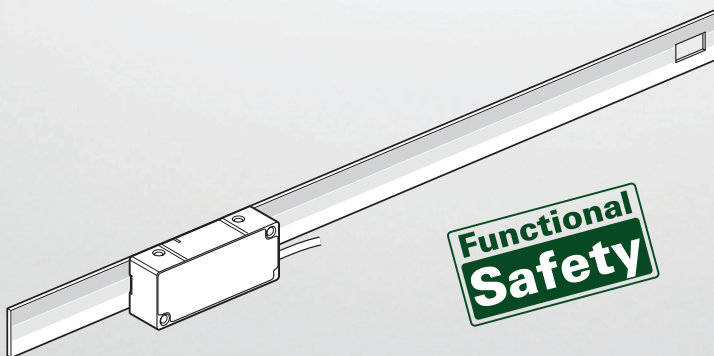


Table of contents

1	Basic information.....	4
1.1	Applicability of the documentation.....	4
1.2	Target groups of the Mounting Instructions.....	4
1.3	Notes on reading the documentation.....	5
1.4	Symbols and fonts used for marking text.....	6
1.5	Notes in this documentation.....	7
1.6	Units and tolerances.....	7
2	Safety.....	8
2.1	Personnel qualification.....	8
2.2	General safety precautions.....	8
3	Items supplied and accessories.....	10
3.1	Items supplied.....	10
3.1.1	Items supplied: LIC 4009 FS parts kit.....	10
3.1.2	Items supplied: LIC 411 FS scanning head.....	11
3.2	Mounting accessories.....	12
3.2.1	Accessories for mounting the parts kit.....	12
3.2.2	Accessories for mounting the scanning head.....	12
4	Mounting.....	13
4.1	Requirements and notes.....	13
4.1.1	Functional safety.....	13
4.2	Mounting the parts kit.....	14
4.2.1	Notes on mounting the parts kit.....	14
4.2.2	Materials and tools.....	14
4.2.3	Bonding the scale tape.....	15
4.3	Mounting the scanning head.....	17
4.3.1	Choosing the mounting variant.....	17
4.3.2	Variant: Mounting with the holder on the side.....	18
4.3.3	Variant: Mounting with the holder at top.....	21
4.3.4	Variant: Mounting with the holder at bottom.....	24

5	Adjustment and diagnosis.....	27
5.1	Choosing the inspection or testing unit.....	27
5.2	Adjustment and diagnosis with PWM inspection unit and ATS.....	28
5.2.1	Requirements and notes.....	28
5.2.2	Continuity check.....	28
5.2.3	Connecting the encoder to the ATS.....	29
5.2.4	Adjusting the scanning head.....	35
5.3	Adjustment and diagnosis with testing unit.....	37
5.3.1	Requirements and notes.....	37
5.3.2	Continuity check.....	37
5.3.3	Connecting the encoder to the PWT.....	38
5.3.4	Adjusting the scanning head.....	42
6	Final steps.....	44
6.1	Connecting the encoder to the downstream electronics.....	44
7	Removal.....	45
7.1	Safety precautions regarding removal.....	45
7.2	Removing the scanning head.....	45
7.3	Disassembling the parts kit.....	45

1 Basic information


This chapter contains information about the product and the Mounting Instructions.

1.1 Applicability of the documentation

These Mounting Instructions are valid for the LIC 4009 FS, LIC 411 FS.

- Prior to using the documentation, check whether the documentation and product model match
- The designation of the product is printed on the ID label.

ID label

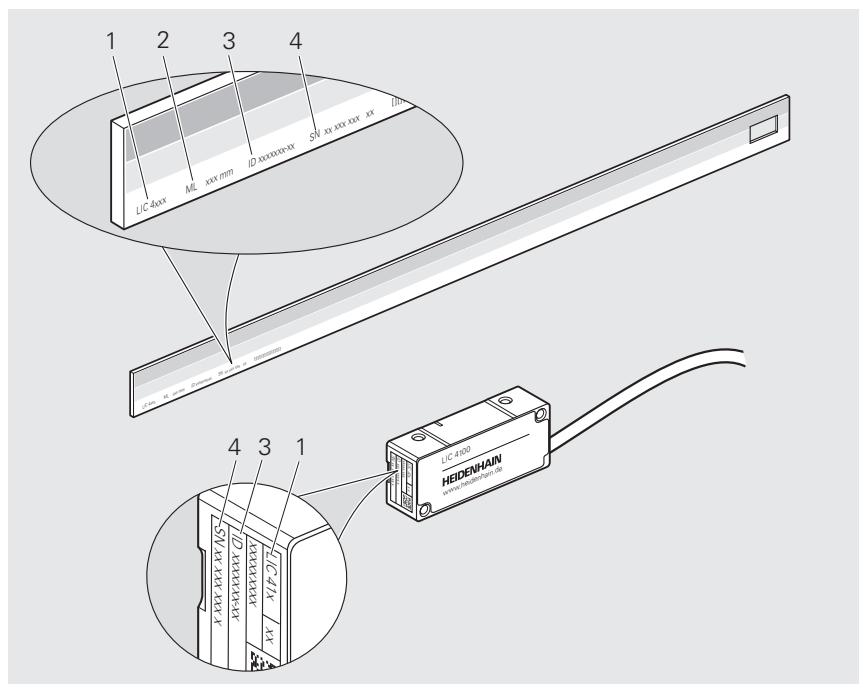

ID label with legend

- 1 Product name
- 2 Measuring length (ML)
- 3 Product ID / Part number (ID)
- 4 Serial number (SN)

1.2 Target groups of the Mounting Instructions

The Mounting Instructions must be read and observed by every person who performs any of the following tasks:

- Design
- Mounting
- Removal

1.3 Notes on reading the documentation

 **WARNING**

Fatal accidents, personal injury or property damage caused by non-compliance with the documentation!

Failure to comply with the documentation may result in fatal accidents, personal injury or property damage.

- ▶ Read the documentation carefully from beginning to end
- ▶ Keep the documentation for future reference

The following table lists the various parts of the documentation in their order of reading priority.

Document type	Description
Addendum	An Addendum supplements or supersedes the corresponding contents of the Operating Instructions and, if applicable, of the Mounting Instructions. If an Addendum is included in the shipment, it has the highest priority for reading. All other documentation content retains its validity.
Operating Instructions	The Operating Instructions contain all of the information and safety instructions for the proper and intended operation of the product. The Operating Instructions (English language version) are included in delivery and can also be downloaded in other languages from www.heidenhain.com/documentation . The Operating Instructions must be read prior to initial operation of the product. The Operating Instructions have the second highest priority for reading.
Mounting Instructions	The Mounting Instructions contain all the information and safety precautions needed for the proper mounting and installation of a product. The Mounting Instructions are not included in delivery and must be downloaded from www.heidenhain.com/documentation . The Mounting Instructions have the third highest priority for reading.

Would you like any changes, or have you found any errors?

We are continuously striving to improve our documentation for you. Please help us by sending your suggestions to the following e-mail address:
userdoc@heidenhain.de

1.4 Symbols and fonts used for marking text

In these instructions the following symbols and fonts are used for marking text:

Format	Meaning
▶ ...	Identifies an action and the result of this action
> ...	Example: ▶ Tilt the shipping brace to remove it (c) > The shipping brace has been removed now
■ ...	Identifies an item of a list
■ ...	Example: ■ Solid contaminants: class 3 ■ Max. pressure dew point: class 4

1.5 Notes in this documentation

Safety precautions

Precautionary statements warn of hazards in handling the product and provide information on their prevention. Precautionary statements are classified by hazard severity and divided into the following groups:

DANGER

Danger indicates hazards for persons. If you do not follow the avoidance instructions, the hazard **will result in death or severe injury**.

WARNING

Warning indicates hazards for persons. If you do not follow the avoidance instructions, the hazard **could result in death or serious injury**.

CAUTION

Caution indicates hazards for persons. If you do not follow the avoidance instructions, the hazard **could result in minor or moderate injury**.

NOTICE

Notice indicates danger to material or data. If you do not follow the avoidance instructions, the hazard **could result in things other than personal injury, such as property damage**.

Informational notes

Informational notes ensure reliable and efficient operation of the product. Informational notes are divided into the following groups:



The information symbol indicates a **tip**.
A tip provides important additional or supplementary information.



The book symbol indicates a **cross reference**.
A cross reference leads to external documentation, for example: further documentation from HEIDENHAIN or another supplier.



The globe symbol represents a **cross reference** to a source on the Internet, e.g. www.heidenhain.com

1.6 Units and tolerances

Unless otherwise specified, the dimensions stated in these Mounting Instructions are given in millimeters.

Unless otherwise specified, the tolerances stated in these Mounting Instructions conform to ISO 8015 and ISO 2768 standards.

mm



Tolerancing ISO 8015
ISO 2768:1989-mH
≤ 6 mm: ±0.2 mm

2 Safety

This chapter provides important safety information needed for the proper mounting and installation of the product.

2.1 Personnel qualification

Mounting, initial setup and removal must be conducted by a qualified specialist under compliance with local safety regulations.

2.2 General safety precautions

WARNING

Danger of electric shock due to connection to unsuitable downstream electronics!

If you connect unsuitable downstream electronics to the product, fatal accidents or severe personal injuries can occur.

- ▶ Connect the product only to downstream electronics whose supply voltage comes from PELV systems

WARNING

Risk of injury due to plug connections under voltage!

If you disengage plug connections while the equipment is under power, this may result in fatal accidents or severe personal injury.

- ▶ Do not engage or disengage any connecting elements while the product is under power

WARNING

Risk of injury from damaged or worn components!

Safety functions can fail if damaged or worn components are installed unintentionally. Failed safety functions can result in death or serious injury.

- ▶ Inspect the component for damage
- ▶ Do not use any damaged or worn components
- ▶ In case of replacement, repair the thread
- ▶ Use new screws, spring pins and nuts
- ▶ Secure screws and nuts with suitable material-bonding anti-rotation lock

CAUTION

Risk of injury due to sharp edges and corners of the scale tape!

If you do not guide the scale tape in a controlled manner during handling, this can cause cuts or eye injuries.

- ▶ Wear protective gloves and safety goggles
- ▶ Guide the scale tape slowly and in a controlled manner during handling
- ▶ Have a second person help you when handling long scale tapes

NOTICE**Property damage due to mechanical stress!**

Exposing the product to mechanical stress can cause damage to the product.

- ▶ Do not drop the product or subject it to major vibration
- ▶ Do not expose the product to mechanical stress
- ▶ Do not change the physical structure of the product

NOTICE**Property damage due to electrical stress!**

Improper handling of the connecting element can cause damage to the product.

- ▶ Do not engage or disengage any connecting elements while the product is under power
- ▶ Do not touch the contacts of the plug connections

NOTICE**Property damage due to electrostatic discharge (ESD)!**

This product contains electrostatically sensitive components that can be destroyed by electrostatic discharge (ESD).



- ▶ It is essential to observe the safety precautions for handling ESD-sensitive components
- ▶ Never touch connector pins without ensuring proper grounding
- ▶ Wear a grounded ESD wristband when handling the connections of the product

3 Items supplied and accessories





This chapter contains information on the items supplied and the available accessories of the product.

3.1 Items supplied

3.1.1 Items supplied: LIC 4009 FS parts kit

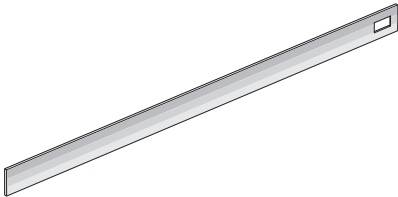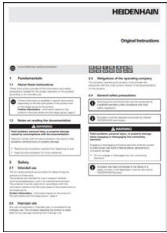Component	Figure
Scale tape	
Mounting aid	
Screw	
Operating Instructions	
Quality Inspection Document	

   
3.1.2 Items supplied: LIC 411 FS scanning head

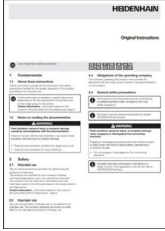Component	Figure
Scanning head	
Fastener kit (M2×16)	
Fastener kit (M2×25)	
Spacer shim (0.15 mm) (not needed)	
Spacer shim (0.75 mm)	
Operating Instructions	
Manufacturer's Inspection Document	


3.2 Mounting accessories

Accessories can be ordered separately from HEIDENHAIN.


3.2.1 Accessories for mounting the parts kit

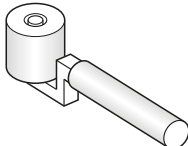Designation	ID	Figure
Roller	276885-01	


3.2.2 Accessories for mounting the scanning head

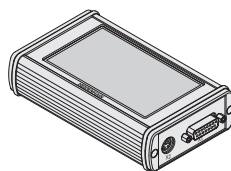Designation	ID	Figure
PWT 101 testing device	1261013-01	


or

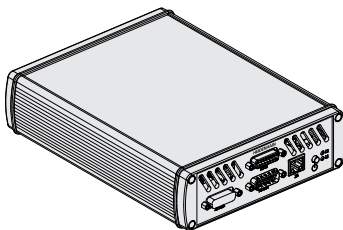PWM 3000 inspection unit	1454173-01	
--------------------------	------------	---

or

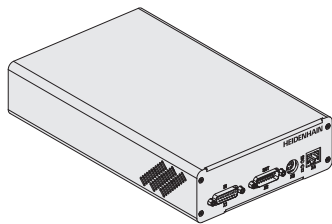PWM 21 inspection unit	1200635-51	
------------------------	------------	---

Adjusting and Testing Software (ATS)

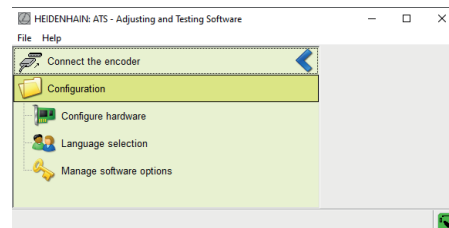

The ATS is available for download free of charge.

- www.heidenhain.com/service/downloads/software/
- Open the **Categories** selection menu
- Select the **Inspection and testing devices** category

4 Mounting

This chapter describes the mounting requirements, different mounting variants, and all other tasks necessary when mounting.


4.1 Requirements and notes

NOTICE

Property damage due to inappropriate tools!

Using inappropriate tools for mounting or removal of the encoder causes damage to the encoder.

- ▶ Do not use hammers
- ▶ Do not use pointed or sharp-edged tools

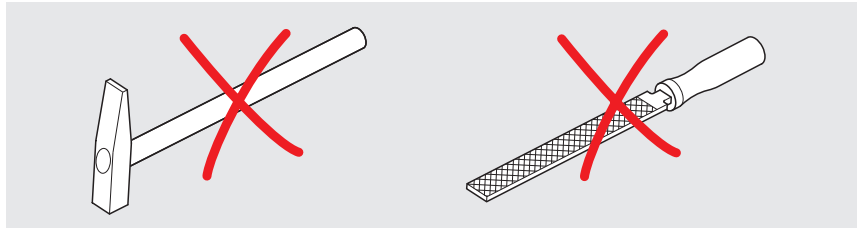



Choose a mounting attitude such that the traverse range is within the measuring length (ML) of the encoder.

(S) = Beginning of measuring length (ML)

Protect the graduation from direct contamination.

In order to ensure correct operation of the encoder, the scale or scale tape must be positioned correctly relative to the scanning head.

Code track at top if cable outlet is to the right.

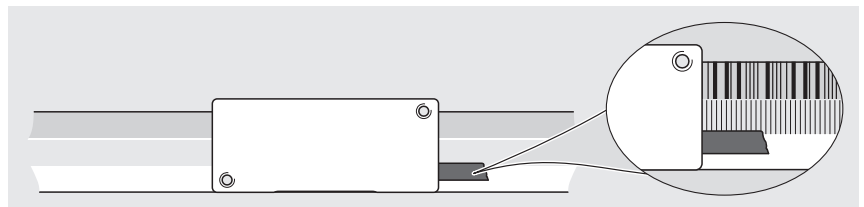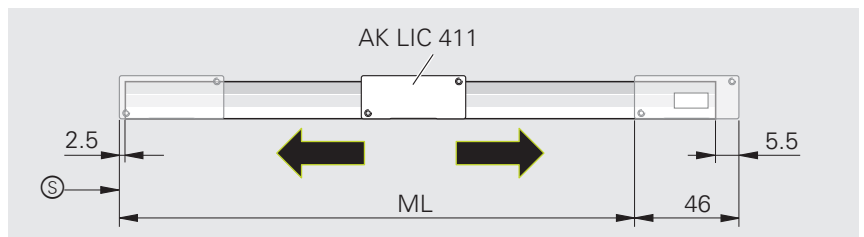

In order to avoid signal interferences, observe the minimum clearance from sources of interference (e.g., power lines).



For more information on sources of interference, refer to the **Interfaces of HEIDENHAIN Encoders** brochure.

- ▶ www.heidenhain.com/documentation
- ▶ Enter the document ID **1078628**

4.1.1 Functional safety

If the machine manufacturer requires fault exclusion for the loosening of the mechanical connection in order to use the encoder, the information on safe mechanical connection must be complied with. The corresponding information is marked with **"For mechanical fault exclusion."**




For more information, see the **Exposed Linear Encoders** brochure.

- ▶ www.heidenhain.com/documentation
- ▶ Enter the document ID **208960**



4.2 Mounting the parts kit

4.2.1 Notes on mounting the parts kit

Please note that the mounting surfaces and threads must be clean and free of burrs and paint.

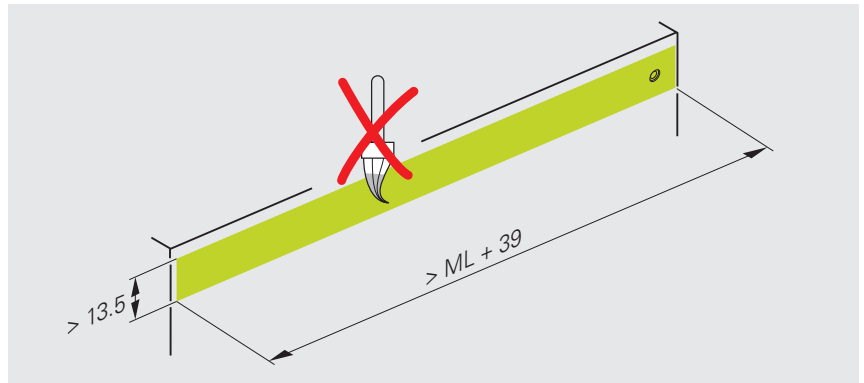

The mounting tolerances refer to the machine guideway (F).

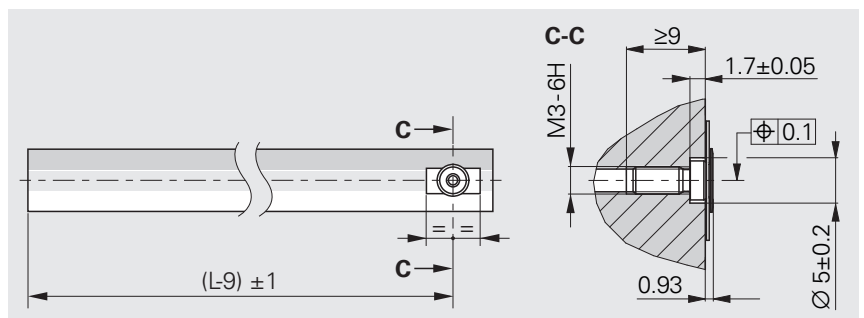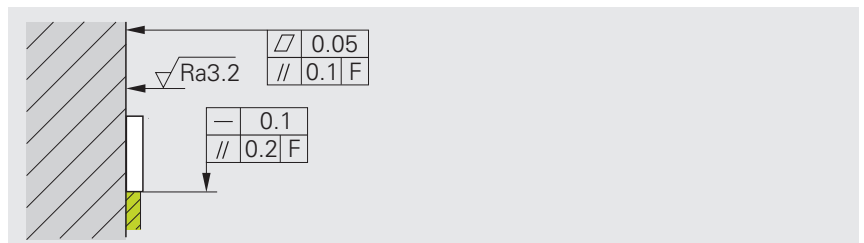

4.2.2 Materials and tools

For this task, the following materials and tools are needed:

Included in delivery

- Mounting aid
- One screw (ISO 10664-10)


To be provided separately

- Aligning rail
- Roller
- Material bonding anti-rotation lock
- Torque wrench (T10 hexalobular socket)


4.2.3 Bonding the scale tape

Attach the scale tape with adhesive mounting film only at a temperature of 15 °C – 35 °C.


Pay attention to the expiration date on the package.

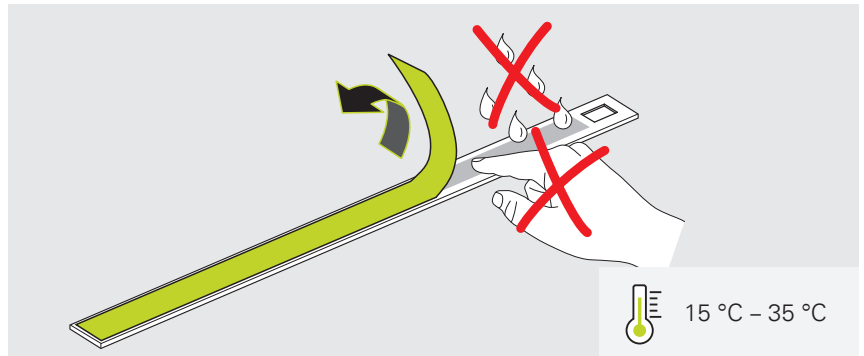

- ▶ Attach the aligning rail
- ▶ Remove about one-third of the protective foil from the adhesive film
- ▶ Use the mounting aid to align the scale tape
- ▶ Gently glue the scale tape along the aligning rail. Remove the protective film while doing so

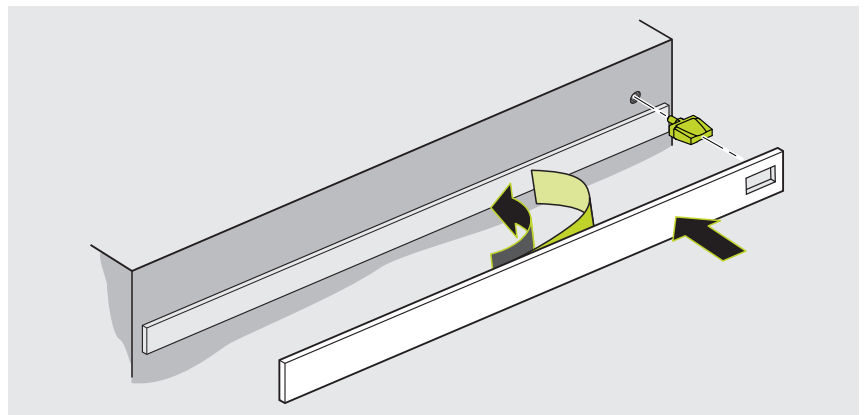


- ▶ Starting from the center, evenly press the scale tape onto the mounting surface using the roller
- ▶ Remove the aligning rail

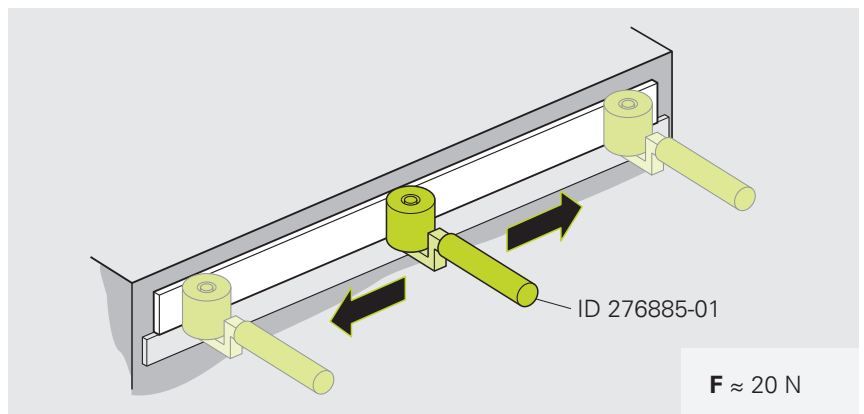

- ▶ **With mechanical fault exclusion:**
Secure the screw connection with suitable material bonding anti-rotation lock




- Tighten the screw with the specified torque

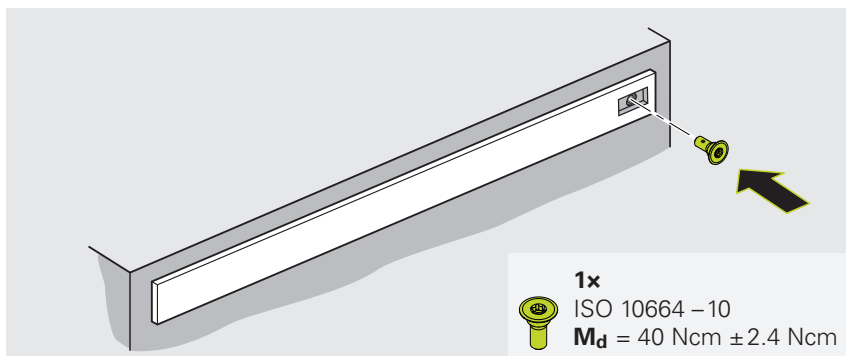

- Do not perform further work on the scale tape until the maximum adhesive force has been reached






The maximum adhesive force of the mounting film is reached at room temperature after approx. 70 hours.

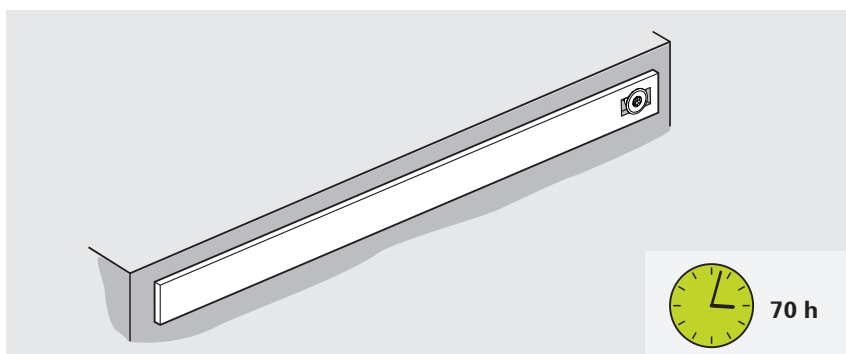

4.3 Mounting the scanning head

4.3.1 Choosing the mounting variant


Mounting variants for the scanning head

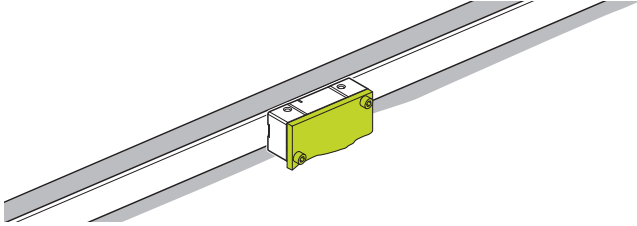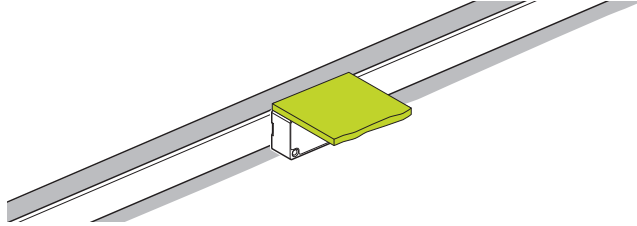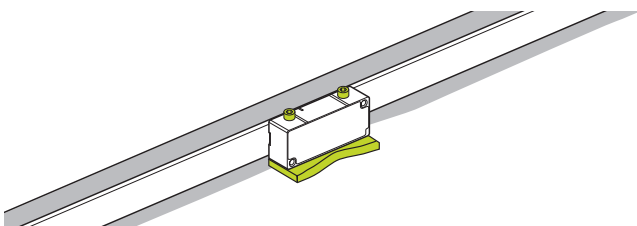Holder on the side	Holder at the top
 Diagram illustrating the side mounting variant. A yellow scanning head is mounted on the side of a grey rail using a white bracket.	 Diagram illustrating the top mounting variant. A yellow scanning head is mounted on top of a grey rail using a white bracket.
Page 18	Page 21
Holder at the bottom	
 Diagram illustrating the bottom mounting variant. A yellow scanning head is mounted on the bottom of a grey rail using a white bracket.	
Page 24	

4.3.2 Variant: Mounting with the holder on the side

This chapter describes how to mount the scanning head with the holder on the side.

An overview of the mounting variants is provided on Page 17.

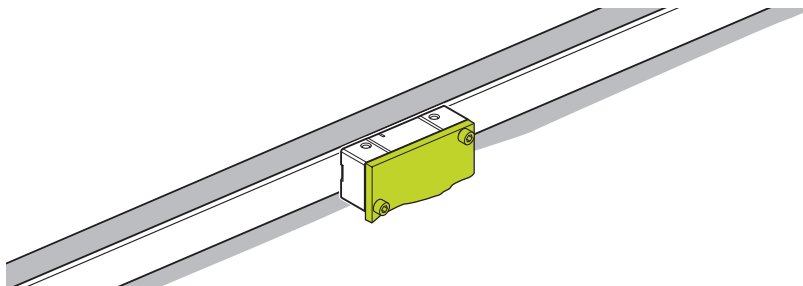

Notes on mounting the scanning head with the holder on the side

NOTICE

Machine acceptance test!

- After installation or replacement of the encoder, perform an acceptance test of the machine in accordance with the manufacturer's specification

Please note that the mounting surfaces and threads must be clean and free of burrs and paint.


- If necessary, clean the graduation and the scanning head with a lint-free cloth and isopropyl alcohol

NOTICE


Property damage due to unsuitable cleaning agents!

The use of inappropriate cleaning agents causes damage to the encoder.

- Use only isopropyl alcohol to clean the encoder
- Clean the encoder with a lint-free cloth

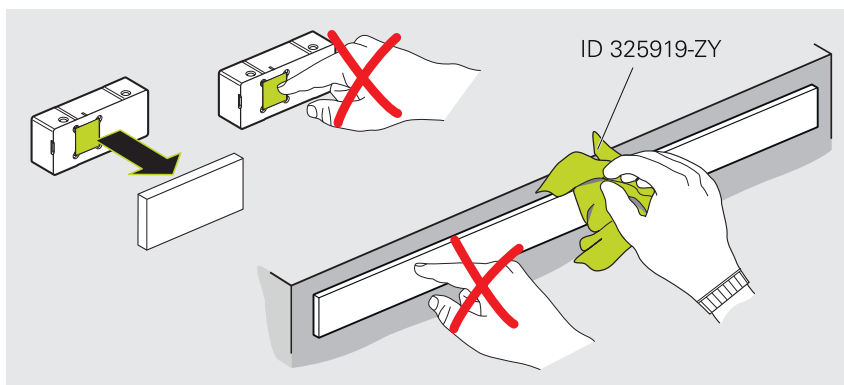

Pay attention to the mounting dimensions. Deviations from the mounting dimensions lead to imprecise measurement results during operation.

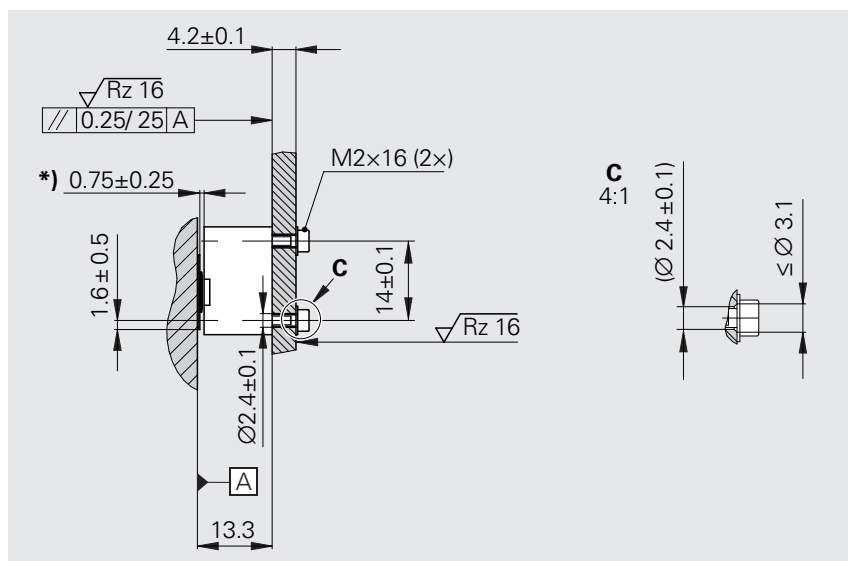

*) Mounting clearance between the scanning head and graduation.

Materials and tools

For this task, the following materials and tools are needed:

Included in delivery

- Spacer shim
- Two screws (M2x16)
- Two washers

To be provided separately

- Torque wrench (hexagon socket for 1.5 mm)


Mounting the scanning head

NOTICE


Requirements for screw connections

- Screw connections must comply with friction class B according to VDI 2230
- Materially bonding threadlocker not permitted for screw connections (friction class B)
- Use the included screws in lubricated condition. Do not clean them
- Fault exclusion is ensured up to a maximum of five fastening repetitions
- If a replacement becomes necessary, use new screws


- ▶ If necessary, remove the protective cap from the scanning head
- ▶ If necessary, remove the protective film from the scale tape

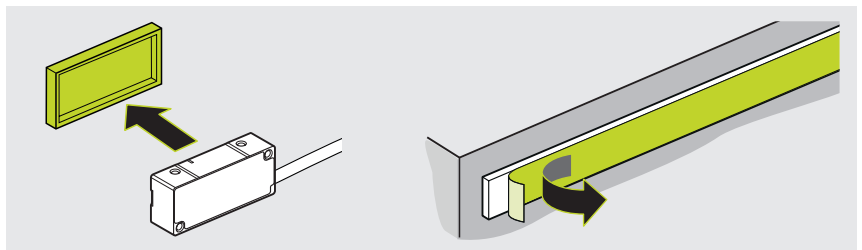

- ▶ Prepare the spacer shim

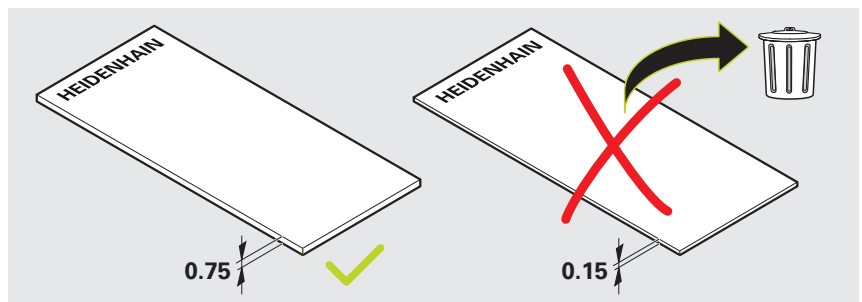

- ▶ Use the spacer shim to set the mounting clearance
- ▶ Lightly screw on the scanning head
- ▶ Remove the spacer shim
- ▶ Ensure that the scanning head does not collide with the screw from the parts kit

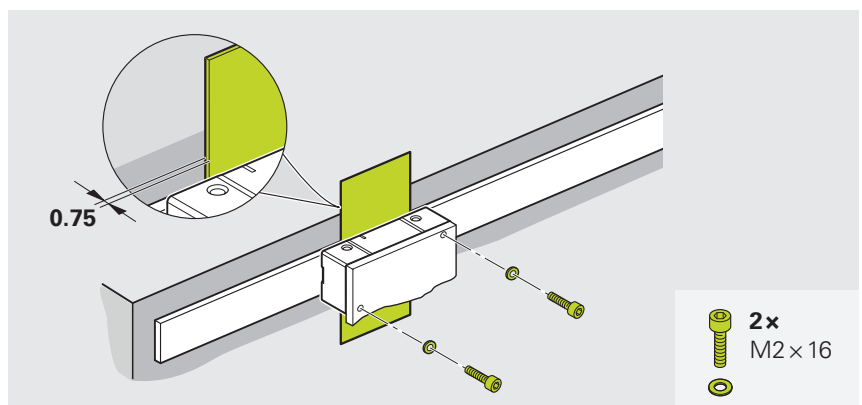


Next step: "Adjustment and diagnosis", Page 27

4.3.3 Variant: Mounting with the holder at top

This chapter describes how to mount the scanning head with the holder at top.

An overview of the mounting variants is provided on Page 17.

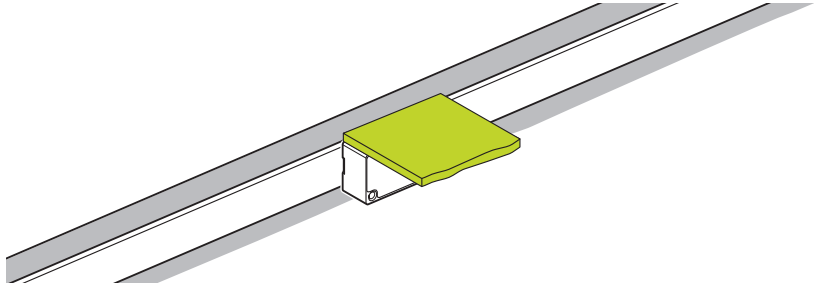

Notes on mounting the scanning head with the holder at top

NOTICE

Machine acceptance test!

- After installation or replacement of the encoder, perform an acceptance test of the machine in accordance with the manufacturer's specification

Please note that the mounting surfaces and threads must be clean and free of burrs and paint.


- If necessary, clean the graduation and the scanning head with a lint-free cloth and isopropyl alcohol

NOTICE


Property damage due to unsuitable cleaning agents!

The use of inappropriate cleaning agents causes damage to the encoder.

- Use only isopropyl alcohol to clean the encoder
- Clean the encoder with a lint-free cloth

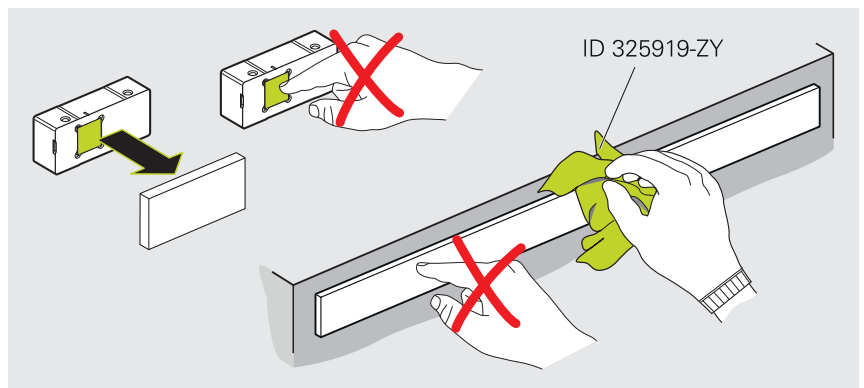

Pay attention to the mounting dimensions. Deviations from the mounting dimensions lead to imprecise measurement results during operation.

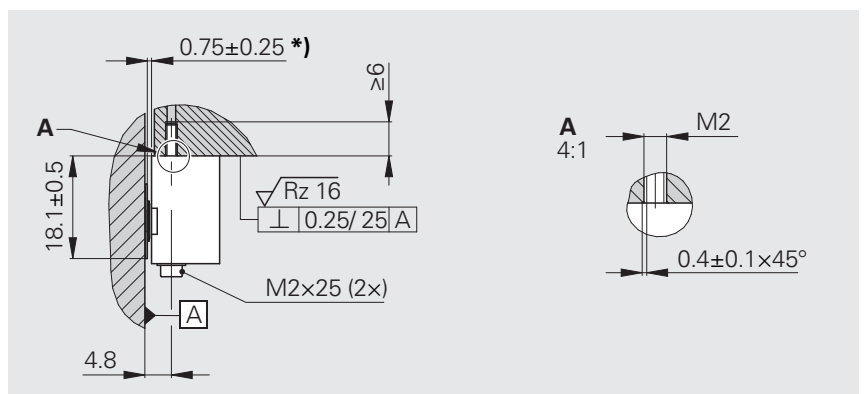

*) Mounting clearance between the scanning head and graduation.

Materials and tools

For this task, the following materials and tools are needed:

Included in delivery

- Spacer shim
- Two screws (M2×25)
- Two washers

To be provided separately

- Torque wrench (hexagon socket for 1.5 mm)


Mounting the scanning head

NOTICE


Requirements for screw connections

- Screw connections must comply with friction class B according to VDI 2230
- Materially bonding threadlocker not permitted for screw connections (friction class B)
- Use the included screws in lubricated condition. Do not clean them
- Fault exclusion is ensured up to a maximum of five fastening repetitions
- If a replacement becomes necessary, use new screws


- ▶ If necessary, remove the protective cap from the scanning head
- ▶ If necessary, remove the protective film from the scale tape

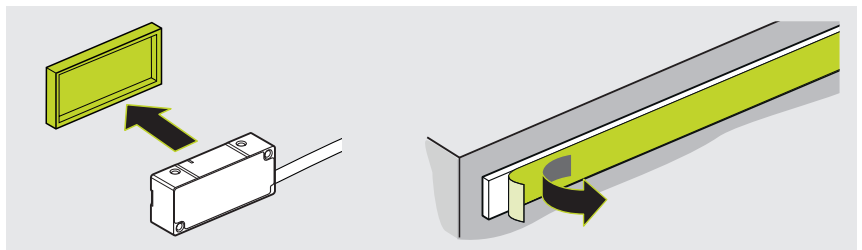

- ▶ Prepare the spacer shim

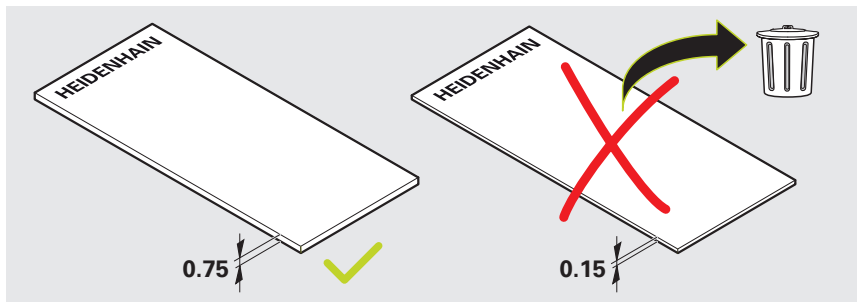

- ▶ Use the spacer shim to set the mounting clearance
- ▶ Lightly screw on the scanning head
- ▶ Remove the spacer shim
- ▶ Ensure that the scanning head does not collide with the screw from the parts kit

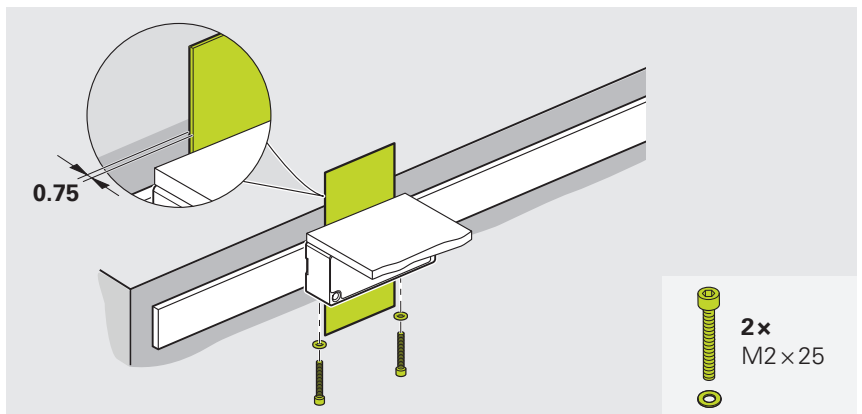


Next step: "Adjustment and diagnosis", Page 27

4.3.4 Variant: Mounting with the holder at bottom

This chapter describes how to mount the scanning head with the holder at bottom.

An overview of the mounting variants is provided on Page 17.

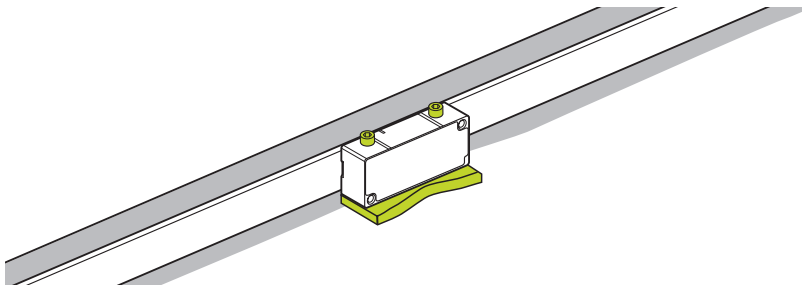

Notes on mounting the scanning head with the holder at bottom


NOTICE

Machine acceptance test!

- After installation or replacement of the encoder, perform an acceptance test of the machine in accordance with the manufacturer's specification

Please note that the mounting surfaces and threads must be clean and free of burrs and paint.

- If necessary, clean the graduation and the scanning head with a lint-free cloth and isopropyl alcohol

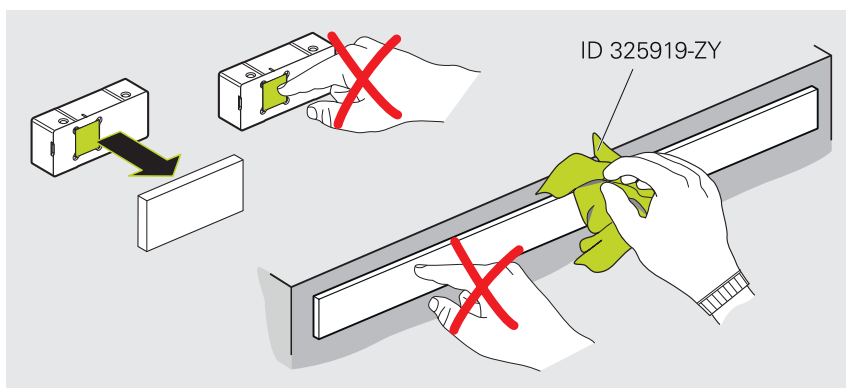


NOTICE

Property damage due to unsuitable cleaning agents!

The use of inappropriate cleaning agents causes damage to the encoder.

- Use only isopropyl alcohol to clean the encoder
- Clean the encoder with a lint-free cloth

Pay attention to the mounting dimensions. Deviations from the mounting dimensions lead to imprecise measurement results during operation.

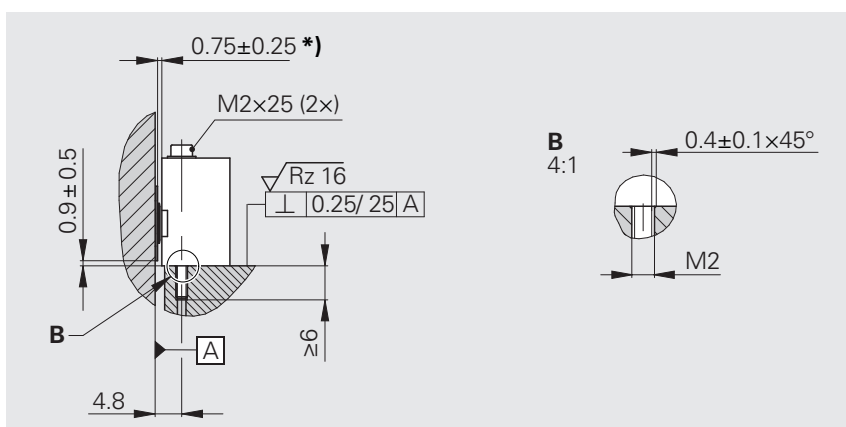

*) Mounting clearance between the scanning head and graduation.

Materials and tools

For this task, the following materials and tools are needed:

Included in delivery

- Spacer shim
- Two screws (M2×25)
- Two washers

To be provided separately

- Torque wrench (hexagon socket for 1.5 mm)


Mounting the scanning head

NOTICE


Requirements for screw connections

- Screw connections must comply with friction class B according to VDI 2230
- Materially bonding threadlocker not permitted for screw connections (friction class B)
- Use the included screws in lubricated condition. Do not clean them
- Fault exclusion is ensured up to a maximum of five fastening repetitions
- If a replacement becomes necessary, use new screws


- ▶ If necessary, remove the protective cap from the scanning head
- ▶ If necessary, remove the protective film from the scale tape

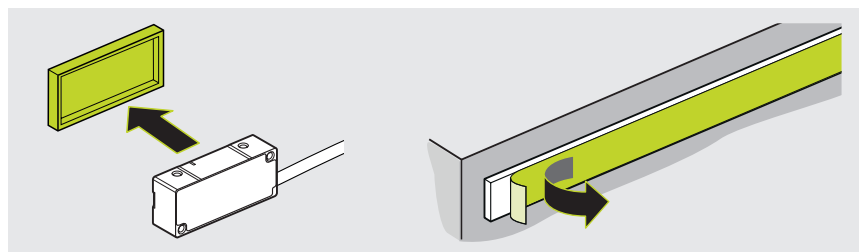

- ▶ Prepare the spacer shim

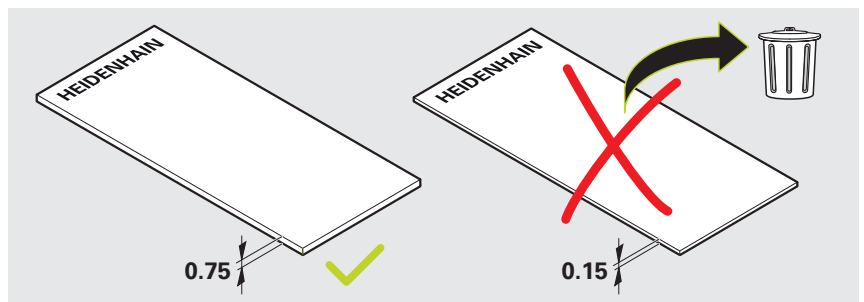

- ▶ Use the spacer shim to set the mounting clearance
- ▶ Lightly screw on the scanning head
- ▶ Remove the spacer shim
- ▶ Ensure that the scanning head does not collide with the screw from the parts kit


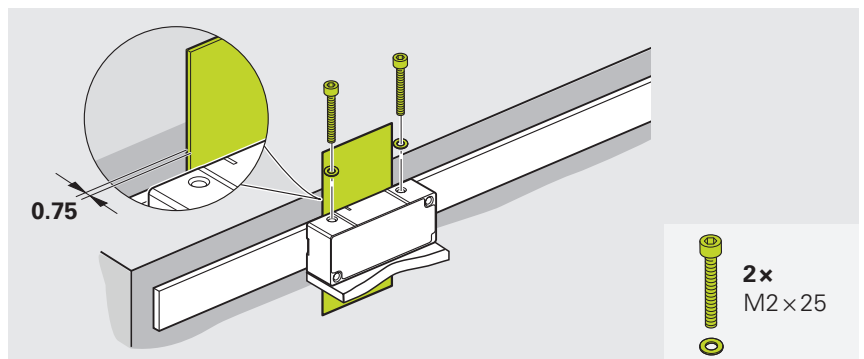


Next step: "Adjustment and diagnosis", Page 27

5 Adjustment and diagnosis

This chapter describes the continuity test as well as the adjustment and diagnosis performed with an inspection unit (e.g., PWM 3000 or PWM 21) and the Adjusting and Testing Software (ATS) or with a testing unit (e.g., PWT 101 or PWT 100).

5.1 Choosing the inspection or testing unit

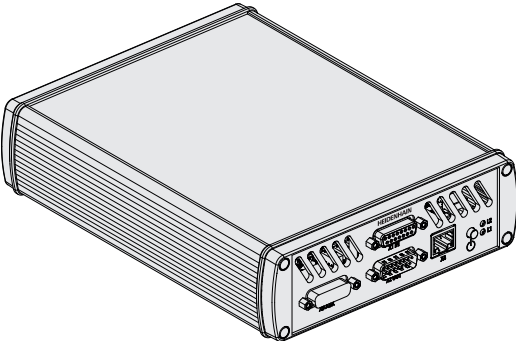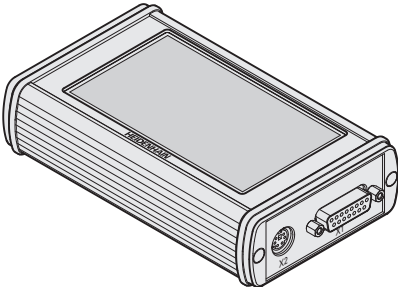Adjustment and diagnosis options	
Adjustment and diagnosis with PWM inspection unit and ATS	Adjustment and diagnosis with testing unit
	
Page 28	Page 37

5.2 Adjustment and diagnosis with PWM inspection unit and ATS

5.2.1 Requirements and notes

The following components are needed for the adjustment and diagnosis of HEIDENHAIN encoders:

- PWM 3000 or PWM 21
- ATS – if a special version (SVxx.x.x) for a specific device is available, use the special version.
If no special version is available, use the latest version (Vx.x.xx).



The ATS is available for download free of charge.

- ▶ www.heidenhain.com/service/downloads/software/
- ▶ Open the **Categories** selection menu
- ▶ Select the **Inspection and testing devices** category



For more information, refer to the applicable **Adjusting and Testing Software** documentation.

- ▶ www.heidenhain.com/documentation
- ▶ Enter the document ID **543734**



For more information, see the **Exposed Linear Encoders** brochure.

- ▶ www.heidenhain.com/documentation
- ▶ Enter the document ID **208960**

5.2.2 Continuity check

Materials and tools

For this mounting step, the following materials and tools are needed:

Included in delivery

To be provided separately


- Resistance measuring device

Measuring the electrical resistance

- ▶ Check the electrical resistance between the connector housing and the machine



The electrical resistance between the connector housing and the machine must be $< 1 \Omega$.

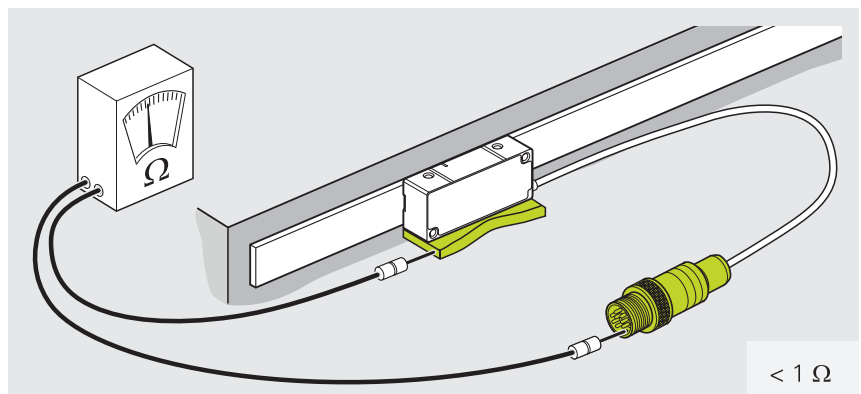

5.2.3 Connecting the encoder to the ATS

Connecting the encoder


- Connect the encoder to the PWM
- Switch on the PWM

Selecting the connection

Connection options	
Connecting the encoder using its ID	Connecting the encoder manually
Recommended option with automatic determination of the measuring parameters. Page 30	Alternative option if the encoder cannot be connected using its ID. Page 32


Connecting the encoder using its ID

- ▶ Double-click **Connect the encoder** in the Function menu
- > The **Operating mode of the testing device** dialog opens.

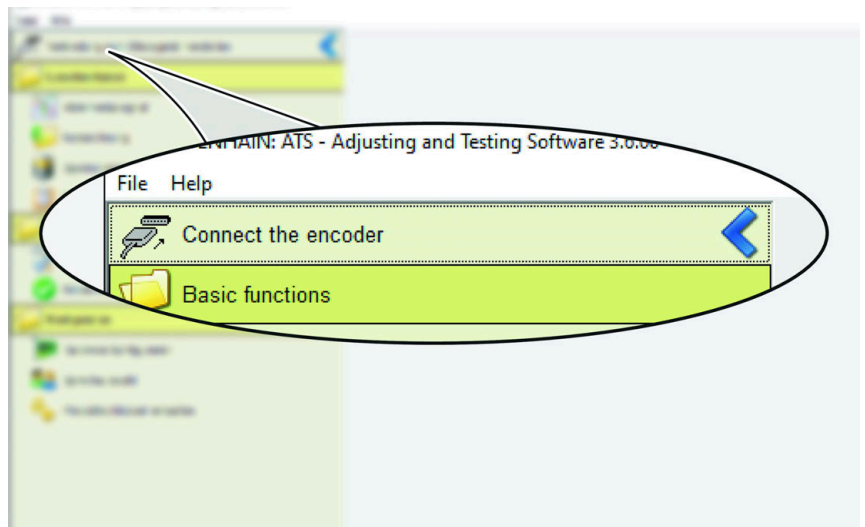


The **Function** menu

- ▶ Select the **Encoder Diagnostics** mode
- ▶ Click **Next**
- > The **Encoder selection** dialog opens.

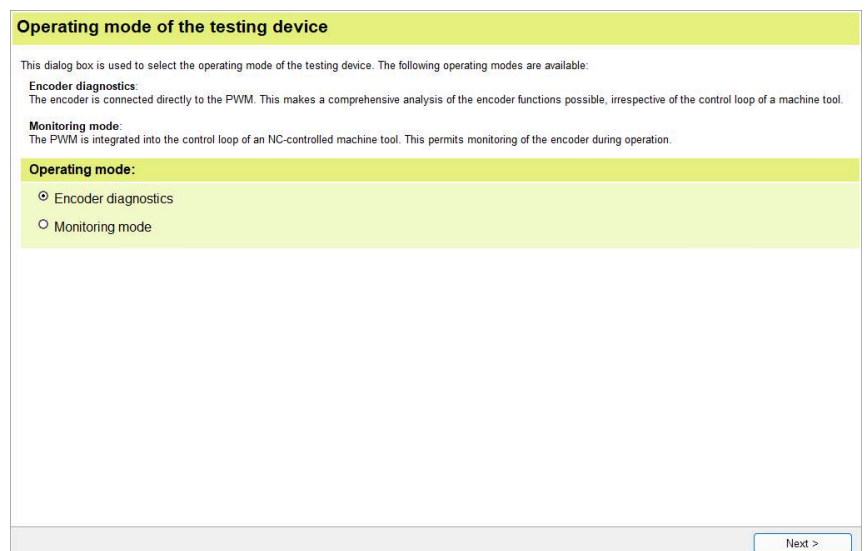

The **Operating mode of the testing device** dialog

- ▶ Enter the product ID of the scanning head in the **ID number** field
- > The determined encoder parameters are shown in the **Encoder data** field.
- ▶ Click **Connect**
- > The connection to the encoder is established.
- > The **Function menu** opens.

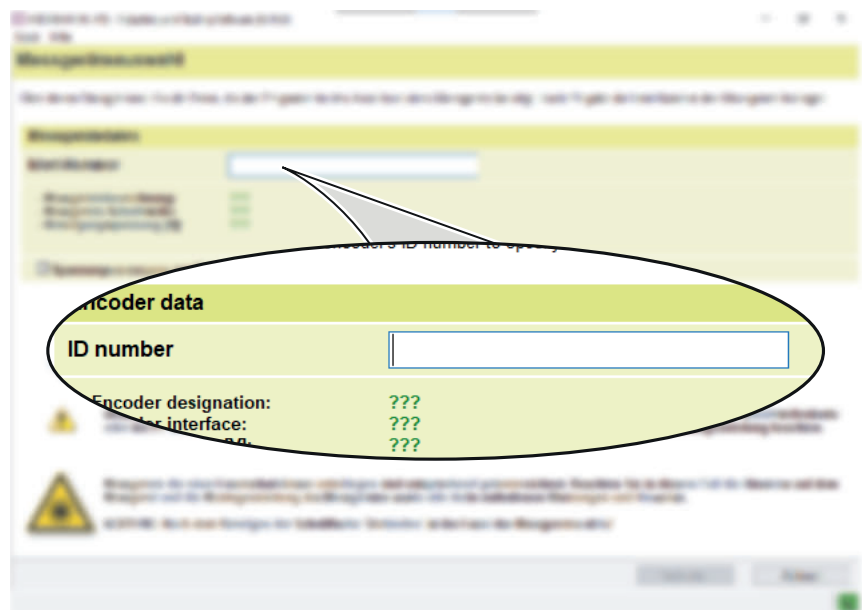

The **Encoder selection** dialog




If you cannot connect the encoder using its ID, proceed as described in the "**Connecting the encoder manually**" chapter.

Next step: "Adjusting the scanning head", Page 35


Connecting the encoder manually

- ▶ Double-click **Connect the encoder** in the Function menu
- > The **Operating mode of the testing device** dialog opens.

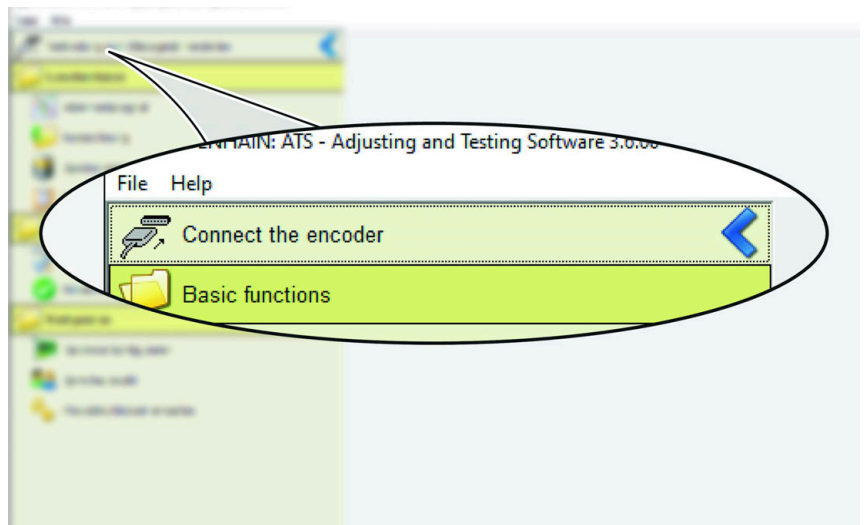


The **Function** menu

- ▶ Select the **Encoder Diagnostics** mode
- ▶ Click **Next**
- > The **Encoder selection** dialog opens.

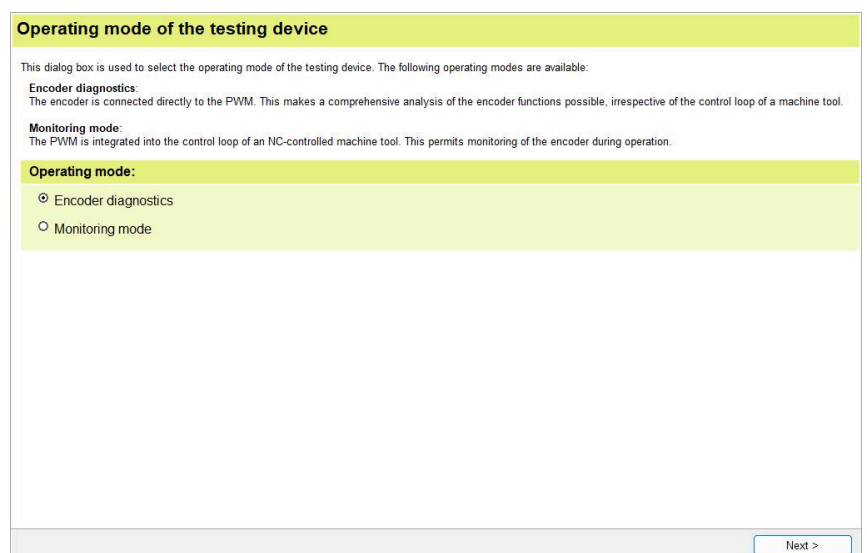

The **Operating mode of the testing device** dialog

- ▶ Click **Manual Settings**
- > The **Encoder selection** dialog opens.

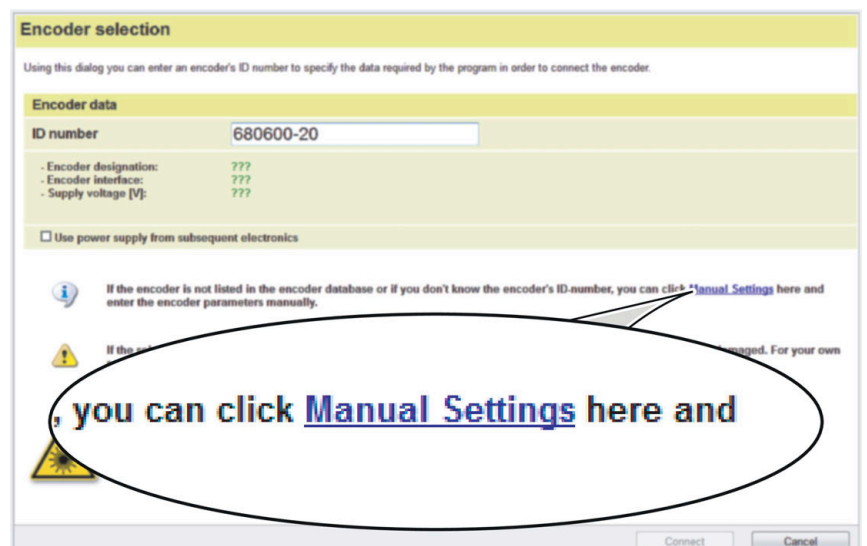

The **Encoder selection** dialog

- ▶ Follow the safety instructions
- ▶ Click **Next**
- The **Encoder selection** dialog opens.

The **Encoder selection** dialog

NOTICE

Property damage due to incorrect encoder data settings!

If you set the encoder data incorrectly, the encoder, the interface card, or the PC may be damaged.

- ▶ Check the encoder data before connecting the encoder

Encoder interface:	EnDat 2.2
Supply voltage [V]:	5.0
Voltage adjustment:	Yes




For more information on the supply voltage and interfaces, refer to the **Exposed Linear Encoders** brochure.

- ▶ www.heidenhain.com/documentation
- ▶ Enter the document ID **208960**

- ▶ Select the permissible encoder supply voltage in the **Encoder supply voltage** section
- ▶ To activate voltage adjustment by the PWM, select the **Adjust voltage over sensor lines** checkbox
- ▶ Select the appropriate interface type in the **Encoder interface** section
- ▶ Click **Mounting code**
- The **Entry of ATS code** prompt appears.


The **Encoder selection** dialog

- ▶ Click **OK**
- The **Encoder selection** dialog with the mounting code opens.

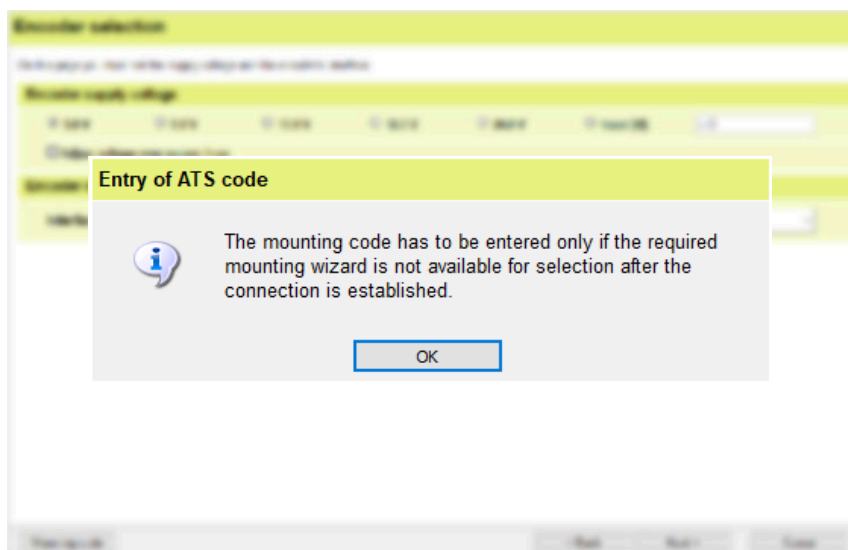


The **Entry of ATS code** message

- ▶ For the **Mounting code**, enter the value:
E001-A005F
- ▶ Click **Next**
- The **Encoder selection** dialog with the encoder data opens.

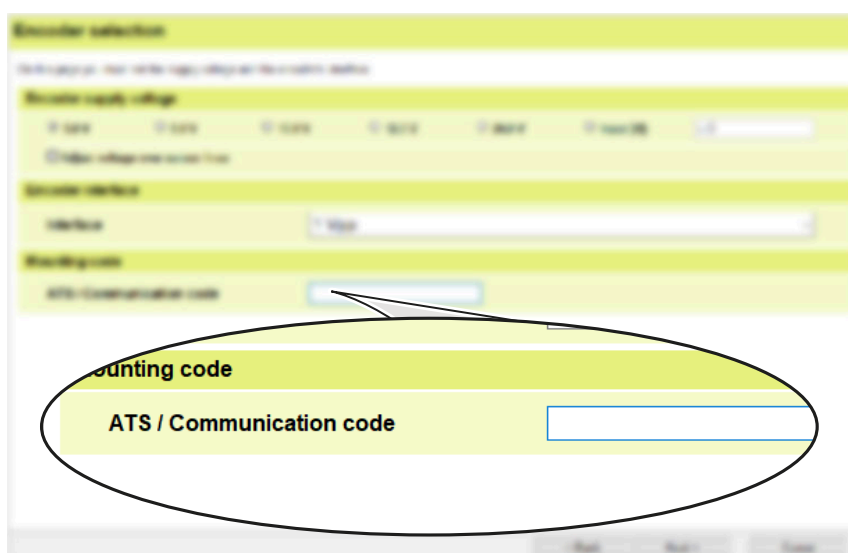

The **Encoder selection** dialog with the mounting code

- ▶ Click **Connect**
- The connection to the encoder is established.
- The **Function menu** opens.

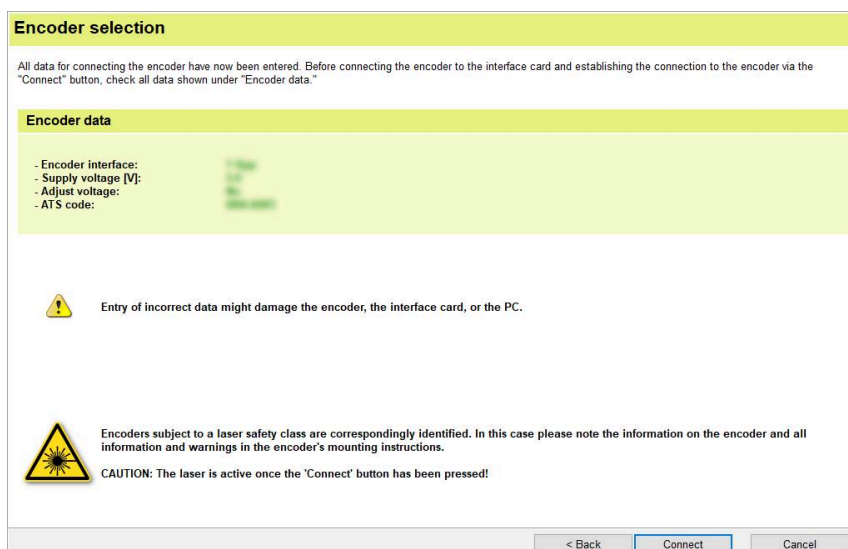


The **Encoder selection** dialog with the encoder data

Next step: "Adjusting the scanning head", Page 35

5.2.4 Adjusting the scanning head

Using the mounting wizard

- ▶ Double-click **LIC mounting**
- ▶ The **LIC mounting wizard** opens.


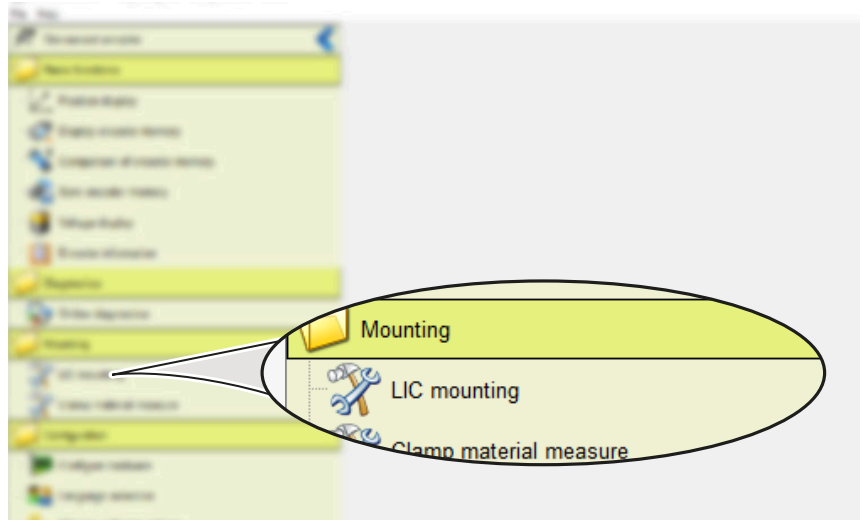


The **Function** menu

Adjust the scanning head in the area of the midpoint of the measuring length.


- ▶ Set the absolute track to the maximum attainable bar length by slightly turning the scanning head
- ▶ Tighten the screws with the specified torque
- ▶ Click **Next**
- ▶ The **Step 2: Verify mounting** dialog opens.

- i** If an error message occurs, it is because the maximum incremental signal was not achieved.
- ▶ Repeat the installation

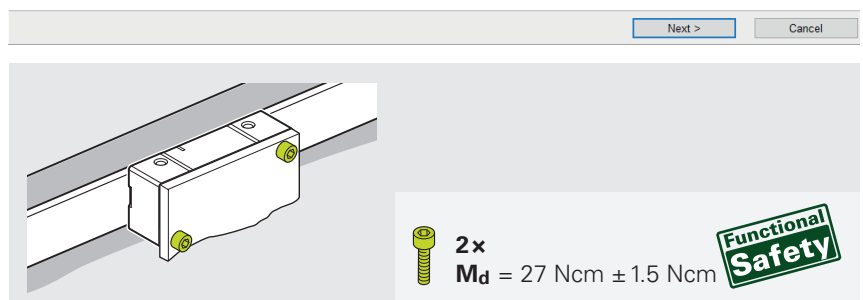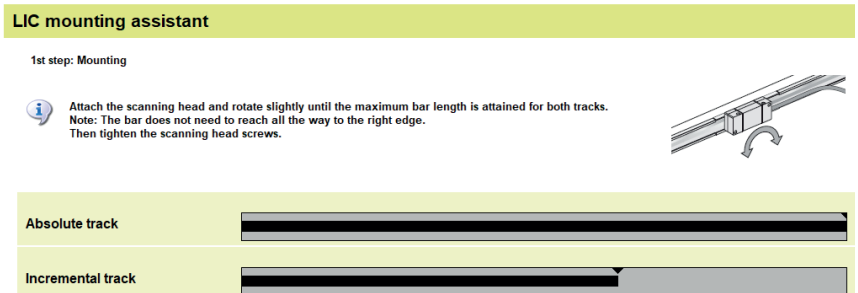


- ▶ Traverse the scanning head over the entire measuring length
- ▶ Ensure that the minimum markers remain within the green ranges

- i** If the green ranges are not reached or if strong signal jitter occurs over the entire measuring length, check the mounting tolerances and inspect for contamination.

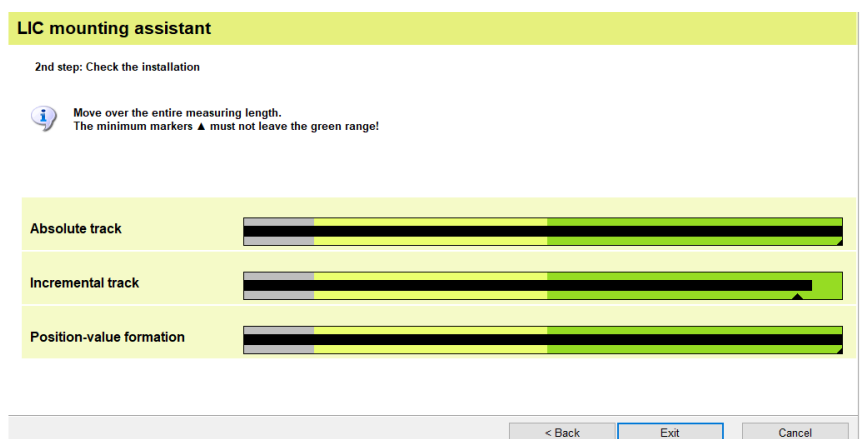


- ▶ Click **Exit**
- > The **Installation successful and functional safety encoder check** message appears.
- ▶ Click **OK**
- > The functional safety encoder check is performed.

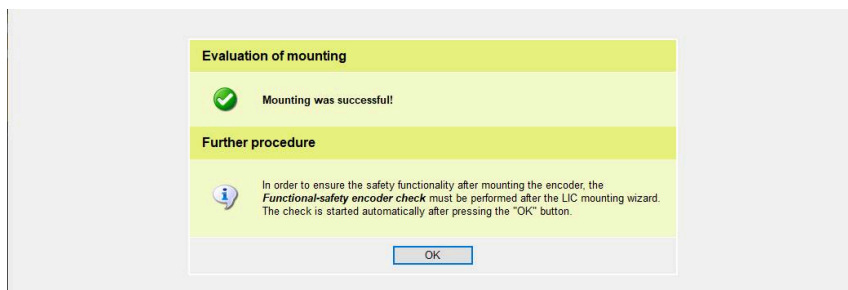


The additional description can be found under **Help > User's Manual**

Chapter: Checking the functional safety of the encoder

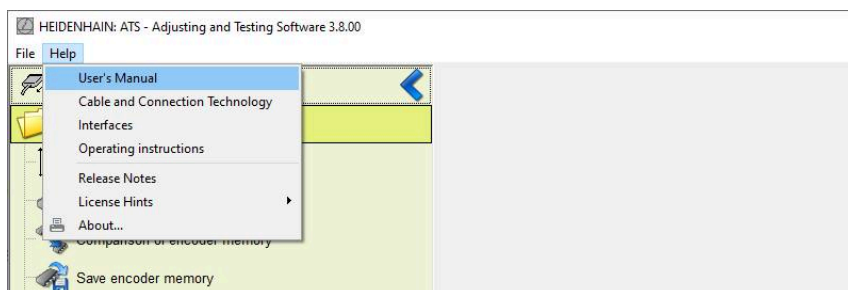

- ▶ Double-click **Disconnect encoder**

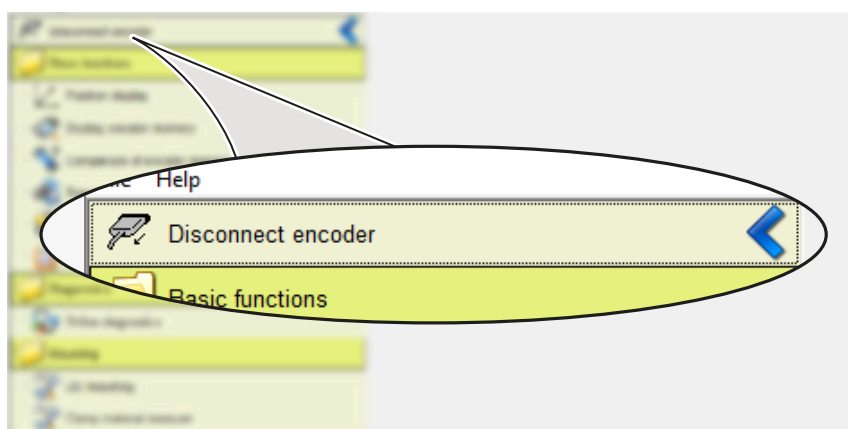

Next step: "Final steps", Page 44

5.3 Adjustment and diagnosis with testing unit

5.3.1 Requirements and notes

A testing unit (e.g., PWT 101 or PWT 100) is needed for the adjustment and diagnosis.



For more information, refer to the **PWT 100/PWT 101 Operating Instructions**.

- ▶ www.heidenhain.com/documentation
- ▶ Enter the document ID **1162581**



For more information, see the **Exposed Linear Encoders** brochure.

- ▶ www.heidenhain.com/documentation
- ▶ Enter the document ID **208960**

5.3.2 Continuity check

Materials and tools

For this mounting step, the following materials and tools are needed:

Included in delivery

To be provided separately


- Resistance measuring device

Measuring the electrical resistance

- ▶ Check the electrical resistance between the connector housing and the machine



The electrical resistance between the connector housing and the machine must be $< 1 \Omega$.

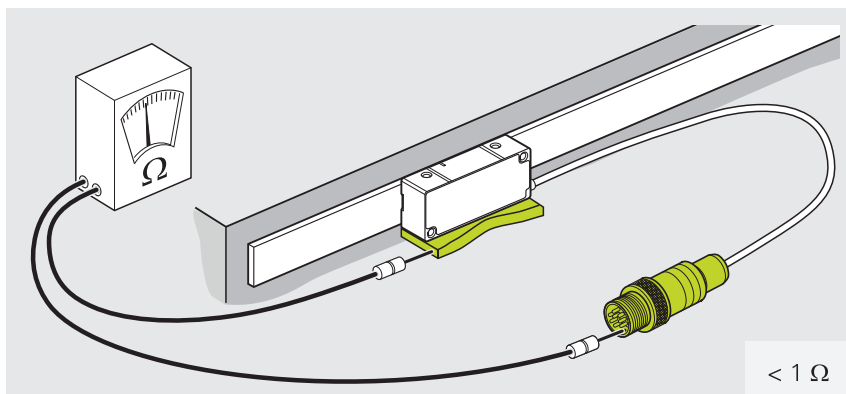

5.3.3 Connecting the encoder to the PWT

Connecting the encoder


- ▶ Connect the encoder to the PWT
- ▶ Connect the PWT to the power supply

Selecting the connection

Connection options	
Connecting the encoder automatically	Connecting the encoder manually
Recommended option with automatic determination of the measuring parameters.	Alternative option if the encoder cannot be connected automatically.
Page 39	Page 40

Connecting the encoder automatically

- ▶ Tap **Automatic Diagnosis** in the main menu
- > The **Automatic Diagnosis** is performed.
- > The **Online diagnostics** screen is opened.

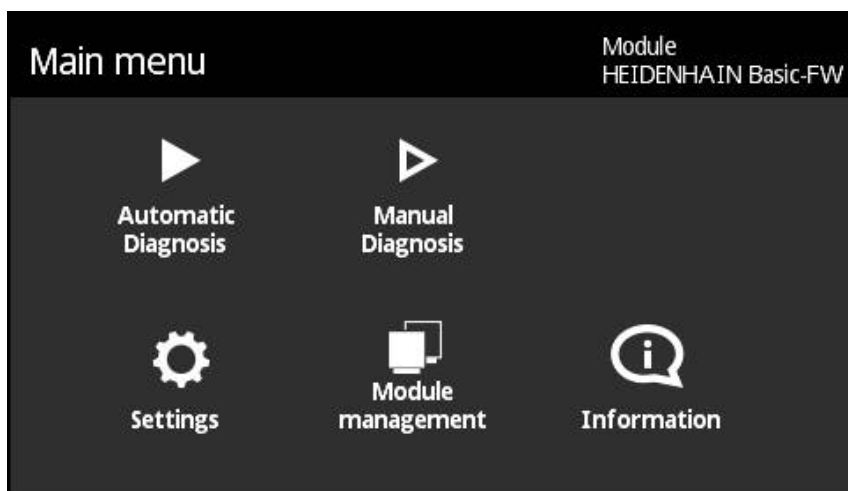

The **Main menu**




If you cannot connect the encoder automatically, proceed as described in the **Connecting the encoder manually** chapter.

Next step: "Adjusting the scanning head", Page 42

Connecting the encoder manually

- ▶ Tap **Manual diagnostics** in the main menu
- ▶ The **Supply voltage of encoder** screen is opened.

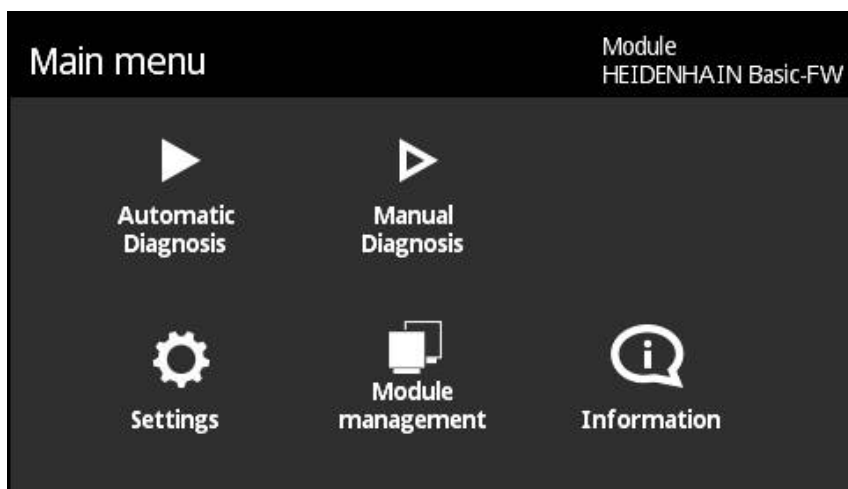

The **Main menu**

NOTICE


Property damage due to incorrect encoder data settings!

If you set the encoder data incorrectly, the encoder, the interface card, or the PC may be damaged.

- ▶ Check the encoder data before connecting the encoder


Encoder interface:	EnDat 2.2
Supply voltage [V]:	5.0
Voltage adjustment:	Yes

- ▶ Select the supply voltage
- ▶ To activate voltage adjustment by the PWT, select the **Adjust supply voltage** checkbox
- ▶ Swipe right to left
- ▶ The **Encoder interface** screen is opened.

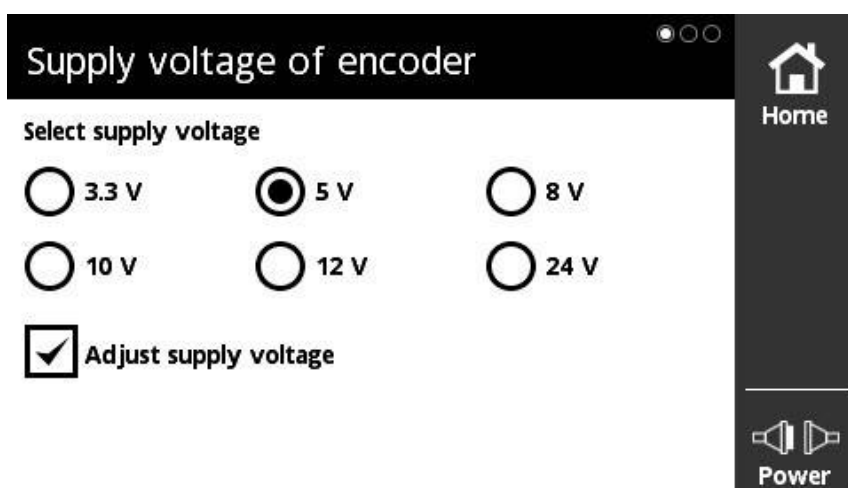


The **Supply voltage of encoder** screen

- ▶ Select the appropriate encoder interface
- ▶ Swipe right to left
- > The **Manual diagnostics** screen is opened.

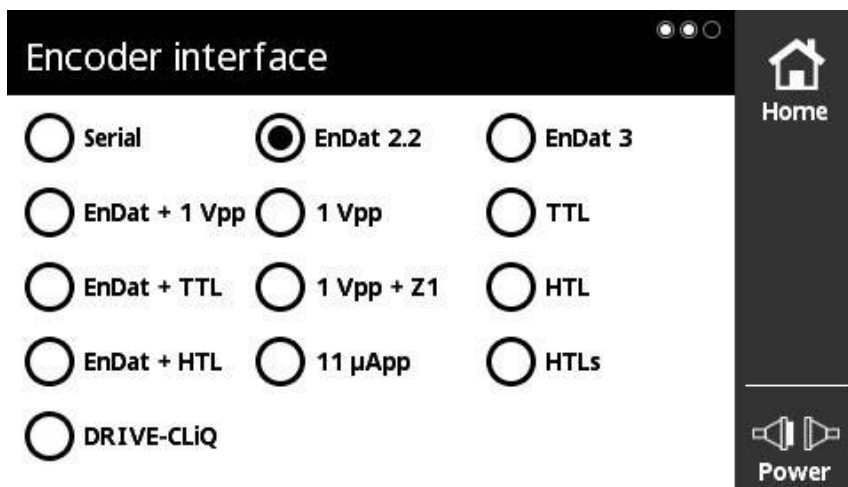The **Encoder interface** screen


- ▶ Check the encoder data
- ▶ Tap **Connect**
- > The connection to the encoder is established.
- > The **Online diagnostics** screen is opened.

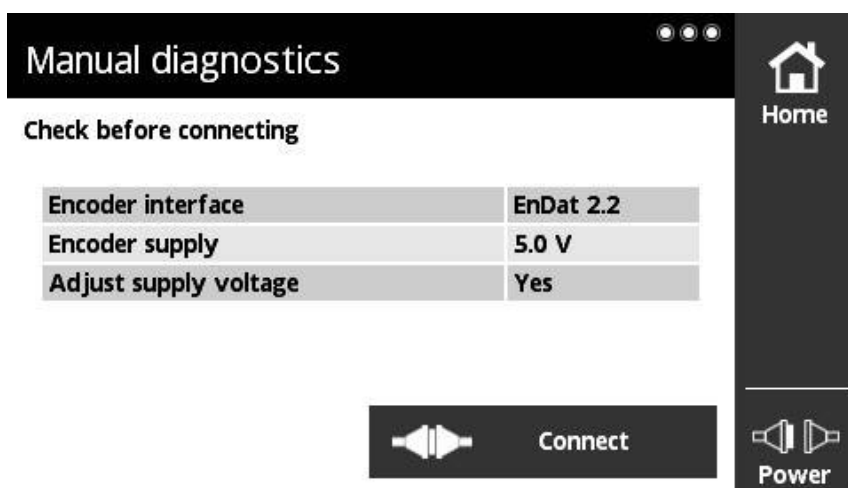The **Manual Diagnosis** screen

Next step: "Adjusting the scanning head", Page 42


5.3.4 Adjusting the scanning head

- Set the absolute track to the maximum attainable bar length by slightly turning the scanning head

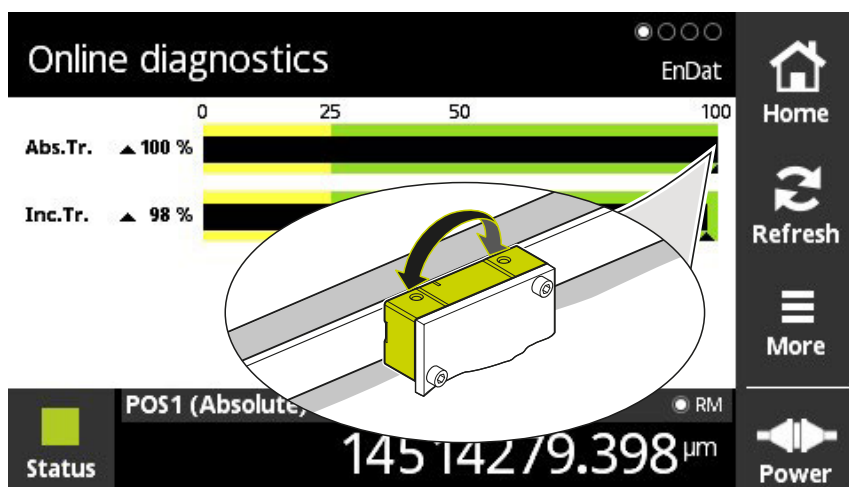


The **Online diagnostics** screen

- Set the incremental track to the maximum value by slightly turning and, if necessary, lightly tapping the scanning head

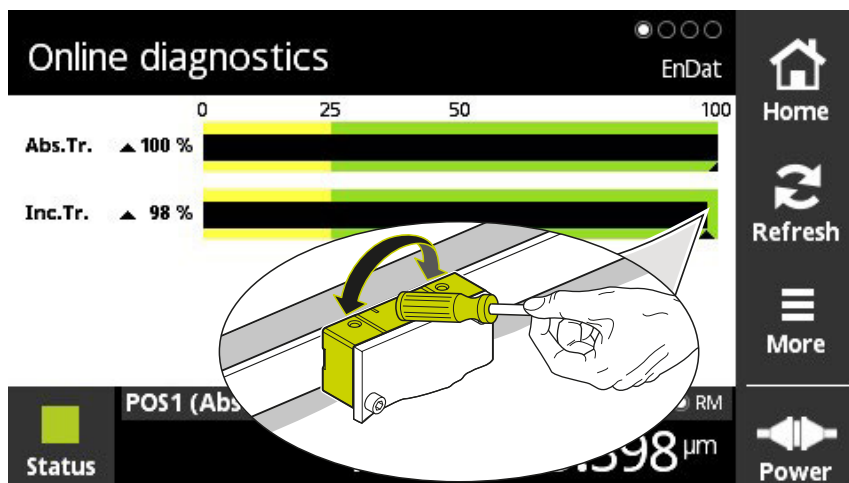

The **Online diagnostics** screen


- Tighten the screws with the specified torque

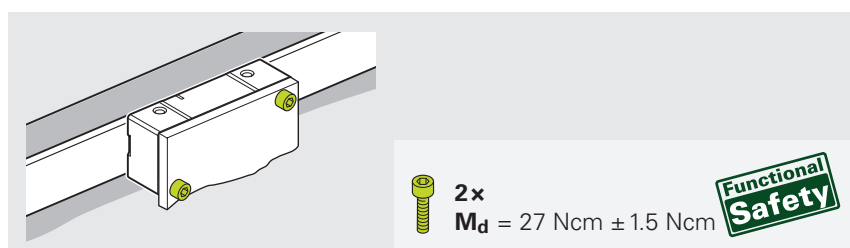

- ▶ Traverse the scanning head over the entire measuring length
- ▶ Ensure that the minimum markers remain within the green ranges



If the green ranges are not reached or if strong signal jitter occurs over the entire measuring length, check the mounting tolerances and inspect for contamination.

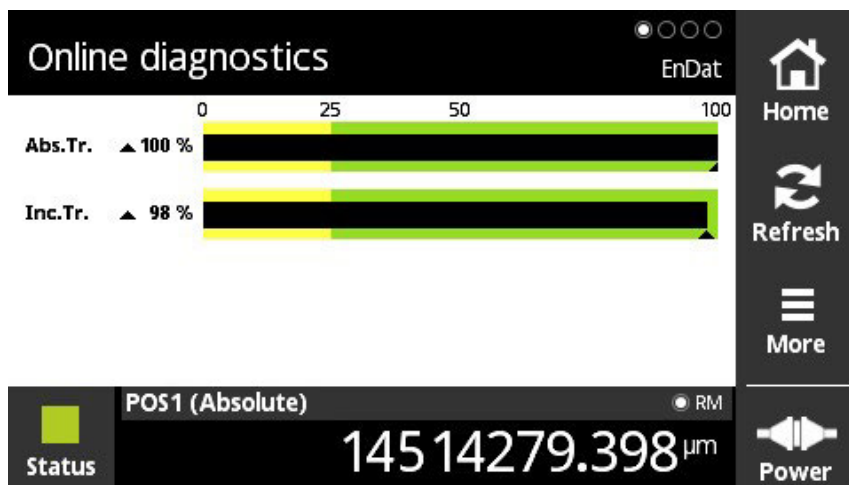

Next step: "Final steps", Page 44

6 Final steps

This chapter describes the necessary final steps.

6.1 Connecting the encoder to the downstream electronics

WARNING

Danger of electric shock due to plug connections under power!

Connecting and disconnecting live cables and connecting elements in the equipment can result in death or serious injury.

- ▶ Do not connect or disconnect any cable or connecting element when they are under power
- ▶ Disconnect the downstream electronics from power before connecting the product
- ▶ For cables without connectors, pay attention to the pin layout

- ▶ Connecting the encoder to the downstream electronics

NOTICE

Property damage resulting from incorrect routing of the connecting cable!

Connecting cables may become damaged as a result of incorrect routing.

- ▶ Observe the maximum permissible bend radii
- ▶ Do not cross connecting cables in drag chains
- ▶ Route connecting cables professionally



For more information on the cable characteristics and cable routing, refer to the **Cables and Connectors** brochure.

- ▶ www.heidenhain.com/documentation
- ▶ Enter the document ID **1206103**



For more information on the pin layouts of pre-assembled cables, refer to the **Cables and Connectors** brochure.

- ▶ www.heidenhain.com/documentation
- ▶ Enter the document ID **1206103**



For more information on sources of interference, refer to the **Interfaces of HEIDENHAIN Encoders** brochure.

- ▶ www.heidenhain.com/documentation
- ▶ Enter the document ID **1078628**

7 Removal

This chapter describes the disassembly of the product.

7.1 Safety precautions regarding removal

WARNING

Risk of injury due to plug connections under voltage!

If you disengage plug connections while the equipment is under power, this may result in fatal accidents or severe personal injury.

- ▶ Do not engage or disengage any connecting elements while the product is under power

WARNING

Risk of injury due to moving machine parts!

Depending on the installation location and the application, there is a high risk of injury due to moving machine parts.

- ▶ Observe all of the machine manufacturer's notes on working on the machine (e.g., always disconnect the machine from the power supply)

CAUTION

Risk of injury from splinters and sharp edges of the carrier material!

If you remove fragile carrier material incorrectly, this can result in material breakage with splinters and sharp edges.

- ▶ Wear protective gloves
- ▶ Wear protective glasses
- ▶ Do not bend or deform the carrier material excessively

7.2 Removing the scanning head

- ▶ Disconnect the encoder from the downstream electronics
 - ▶ Remove the scanning head in the reversed sequence of mounting
- Further information:** "Mounting the scanning head", Page 17

7.3 Disassembling the parts kit



Further information can be found in the **Disassembly Instructions**.

- ▶ www.heidenhain.com/documentation
- ▶ Enter the document ID **1185755**

HEIDENHAIN

DR. JOHANNES HEIDENHAIN GmbH

Dr.-Johannes-Heidenhain-Straße 5

83301 Traunreut, Germany

☎ +49 8669 31-0

☎ +49 8669 32-5061

info@heidenhain.de

Technical support ☎ +49 8669 32-1000

Measuring systems ☎ +49 8669 31-3104

service.ms-support@heidenhain.de

NC support ☎ +49 8669 31-3101

service.nc-support@heidenhain.de

NC programming ☎ +49 8669 31-3103

service.nc-pgm@heidenhain.de

PLC programming ☎ +49 8669 31-3102

service.plc@heidenhain.de

APP programming ☎ +49 8669 31-3106

service.app@heidenhain.de

www.heidenhain.com