



Achtung:

Die Parameter im Speicherbereich des OEM müssen im Servicefall angeglichen werden.

CAUTION:

The parameters in the OEM memory area must be adjusted if service becomes necessary.

Attention:


Les paramètres de la zone de mémorisation du constructeur de la machine doivent être mis à jour en cas de service après-vente.

Attencione:


In caso di assistenza tecnica, i parametri nella memoria OEM devono essere adattati.

Atención


Los parámetros del área de memoria del OEM deben ser ajustados en caso de servicio.

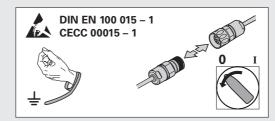

HEIDENHAIN

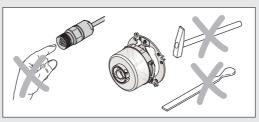

Montageanleitung
Mounting Instructions
Instructions de montage
Istruzioni di montaggio
Instrucciones de montaje

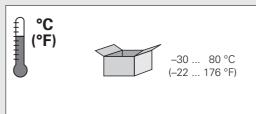

ECN 413 EnDat01 **EQN 425** EnDat01

11/2005

DR. JOHANNES HEIDENHAIN GmbH

Dr.-Johannes-Heidenhain-Straße 5

83301 Traunreut, Germany

② +49 (8669) 31-0

[AX] +49 (8669) 5061

E-Mail: info@heidenhain.de

Technical support

Measuring systems +49 (8669) 32-1000

Measuring systems +49 (8669) 31-3104

E-Mail: service.ms-support@heidenhain.de

E-Mail: service.nc-pgm@heidenhain.de

PLC programming ② +49 (8669) 31-3102

E-Mail: service.plc@heidenhain.de

www.heidenhain.de







Ve 00


571 793-91 · 6 · 5/2007 · E · Printed in Germany · Änderungen vorbehalten

 $\textit{Subject to change without notice} \cdot \textit{Sous réserve de modifications} \cdot \textit{Con riserva di modifiche} \cdot \textit{Sujeto a modificaciones}$

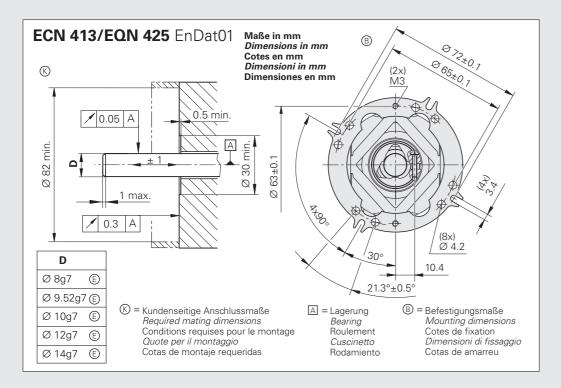

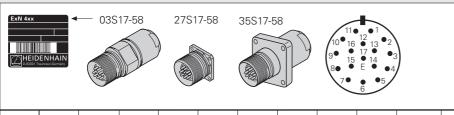


7	1	10	4	15	16	12	13	14	17	8	9	11
5 V U _P	U _P sensor	0 V U _N	0 V sensor	A+	A –	B+	В-	DATA	DATA	CLOCK	CLOCK	1)
br/gn BN/GN	bl <i>BL</i>	ws/gn WH/GN	ws WH	gn/sw GN/BK	ge/sw YL/BK		rt/sw RD/BK	gr <i>GY</i>	rs PK	vio VI	ge YL	

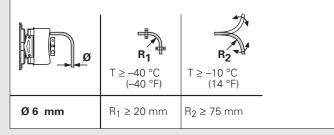

1) Innenschirm
Internal shield
Blindage interne
Schermo interno
Blindaje interno

Außenschirm auf Gehäuse External shield on housing Blindage externe sur boîtier Schermo esterno sulla carcassa Blindaje externo a carcasa

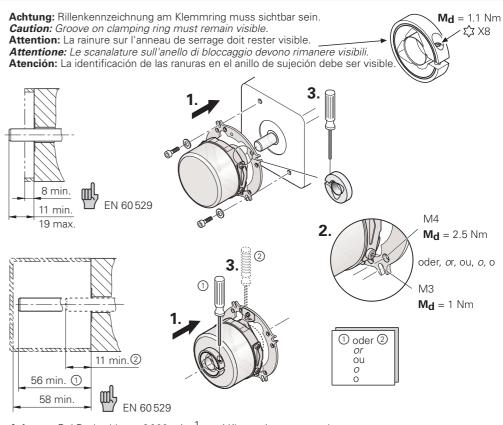

Achtung: Bei Drehzahlen $> 6000 \text{ min}^{-1} \text{ zwei Klemmringe verwenden}.$

Caution: For shaft speeds > 6000 rpm, use two clamping rings.

Attention: Avec vitesses de rotation > 6 000 tours/min., utiliser deux bagues de serrage.

Attentione: con velocità > 6 000 min⁻¹ utilizzare due anelli di fissaggio. **Atención:** En velocidades > 6.000 min⁻¹ utilizar dos bridas de fijación.

