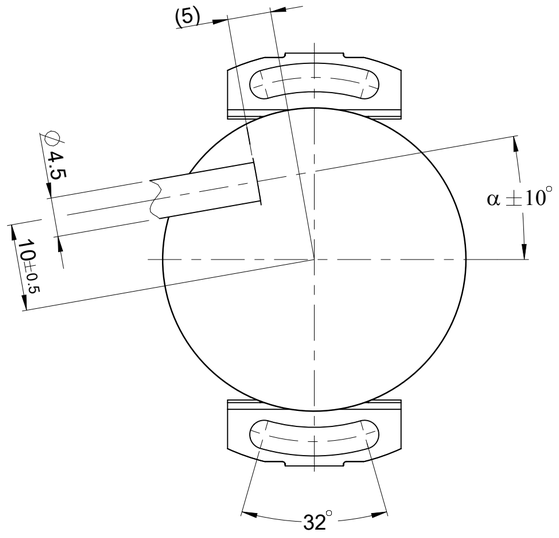

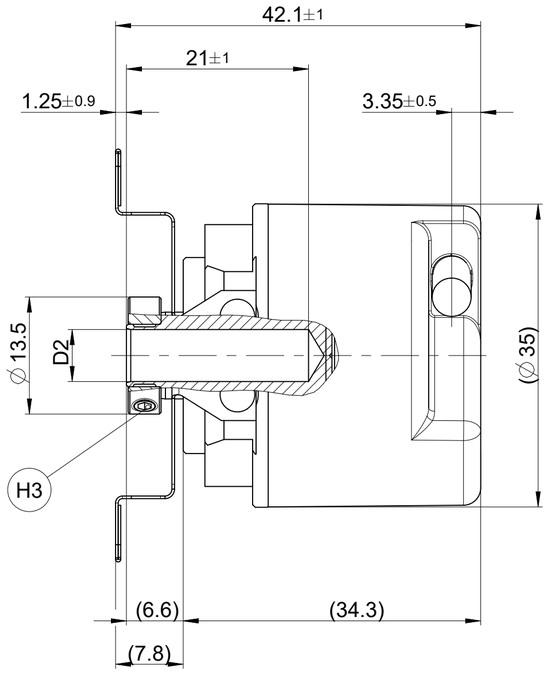

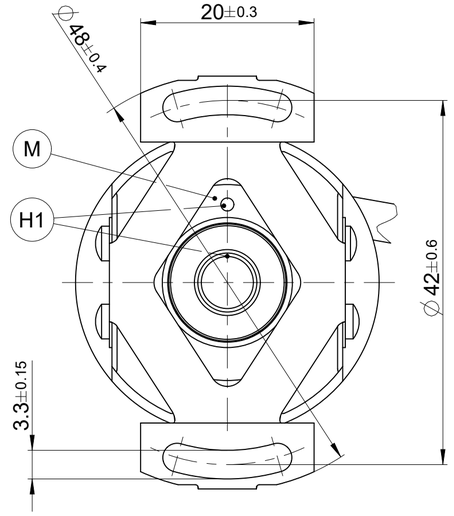

A = Lagerung Kundenwelle
Bearing for customer shaft

K = Kundenseitige Anschlussmaße
Required mating dimensions

M = Messpunkt Arbeitstemperatur
Operating temperature measuring point

H1 = Referenzmarken-Lage ±20°
Reference mark position ±20°

H2 = Maximal zulässige Bewegung der Motorwelle
Max. tolerable movement of the customer shaft

H3 = 2x Schraube Klemmring. Anzugsmoment 0,6 ±0,1Nm
2x screw clamping ring. Torque 0,6 ±0,1Nm SW 1.5

H4 = Anzugsmoment 1,0 ±0,1Nm
Torque 1,0 ±0,1Nm

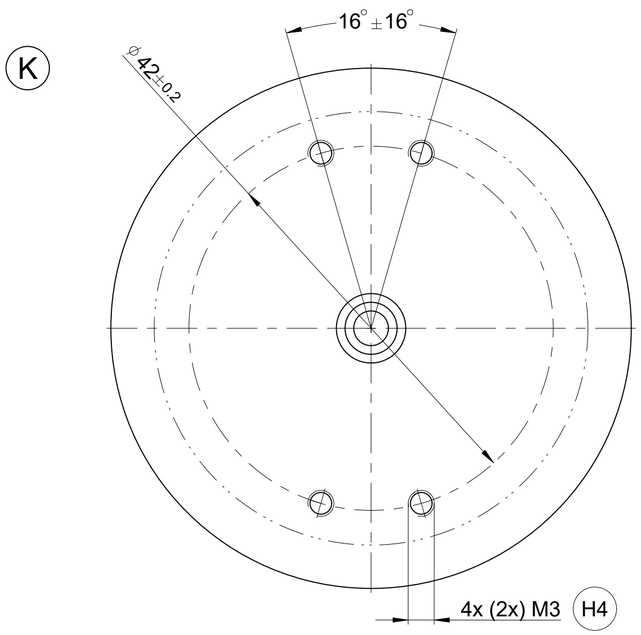

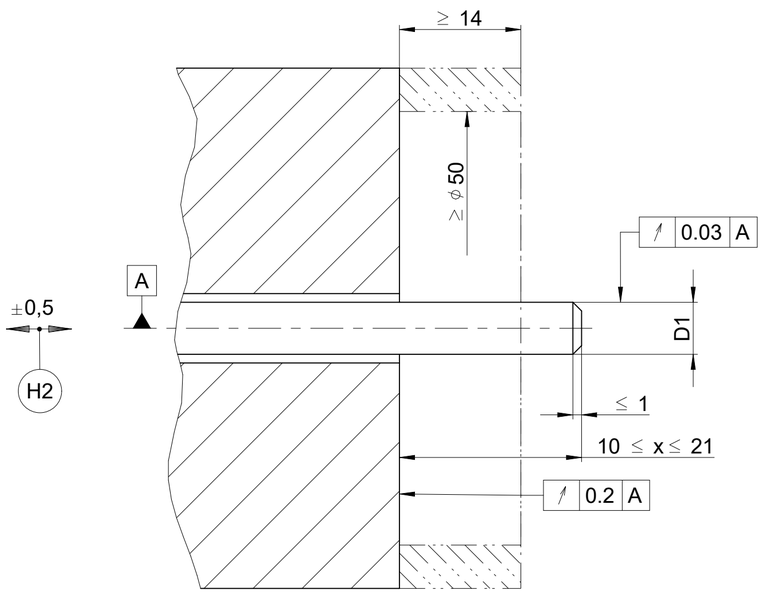

					α = 10°	α = 2°
50C	14A	49A	⌀4 g7 (E)	(⌀4)	..	Z1
50E	14A	49A	⌀6 g7 (E)	(⌀6)	..	Z1
50F	14A	49A	⌀6,35 g7 (E)	(⌀6,35)	..	Z1
WELLA1	KUPPA1	FOKAA1	D1	D2	ZUTEA1	ZUTEA1

ID number:
Change No. C172391-5
Phase: Serie

Original drawing
Scale 2:1 | Format A2
Dimensions in mm

ERN 10xx 50x 14A 49A ../Z1
ERN 10xx 50x 14A 49A ../Z1
Anschlussmaße / Mating Dimensions

Tolerances as per ISO 8015
General Tolerances ISO 2768:1989-mH ≦6mm:±0,2

The reproduction, distribution and utilization of this document as well as the communication of its contents to others without express authorization is prohibited. Offenders will be held liable for the payment of damages. All rights reserved in the event of the grant of a patent, utility model or design. (ISO 16016)

HEIDENHAIN
DR. JOHANNES HEIDENHAIN GmbH
83301 Traunreut, Germany

Released	Version	Revision	Sheet	Page
08.04.2025				1 of 1

D 520910-02-B-01
Document number

886 200 A2